




8 Quail Place Hamilton Lake Hamilton New Zealand

Cavity Fix Nailing Setout Detail

1:2@A4 Dec 2019 Fig 1 Scale Date Dwg

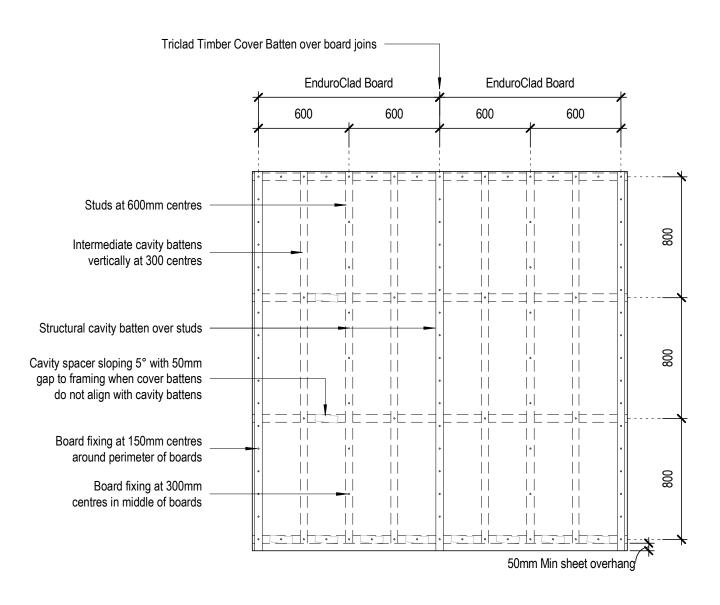

NOTE:

Where cover battens do not sit over a stud it is recommended that additional nogging is used to provide additional fixing for the decorative cover battens.




8 Quail Place Hamilton Lake Hamilton New Zealand

Cavity Fix Framing/Batten Setout-600mm

 1:25@A4
 Dec 2019
 Fig 2a

 Scale
 Date
 Dwg

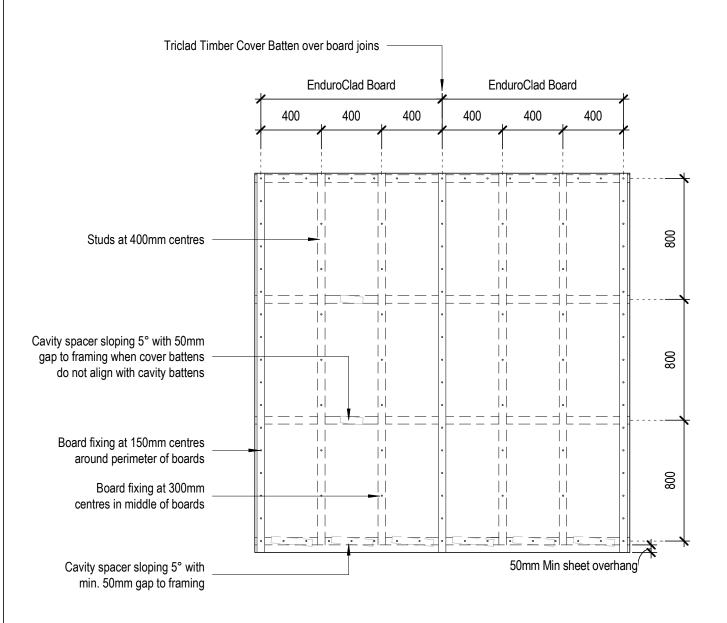

NOTE:

Where cover battens do not sit over a stud it is recommended that additional nogging is used to provide additional fixing for the decorative cover battens.




8 Quail Place Hamilton Lake Hamilton New Zealand

Cavity Fix Framing/Batten Setout-400mm

 1:25@A4
 Dec 2019
 Fig 2b

 Scale
 Date
 Dwg

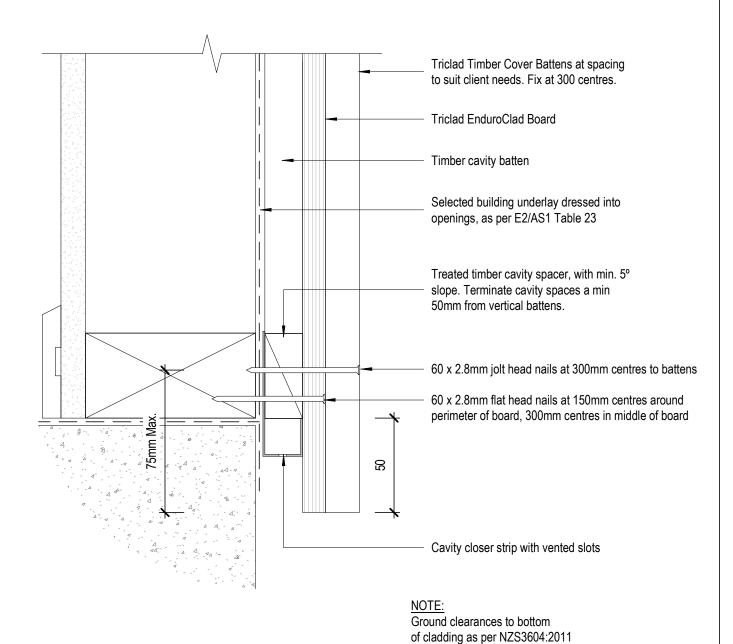




8 Quail Place Hamilton Lake Hamilton New Zealand

Cavity Fix Base Detail-Concrete Floor

 1:2@A4
 Dec 2019
 Fig 3

 Scale
 Date
 Dwg

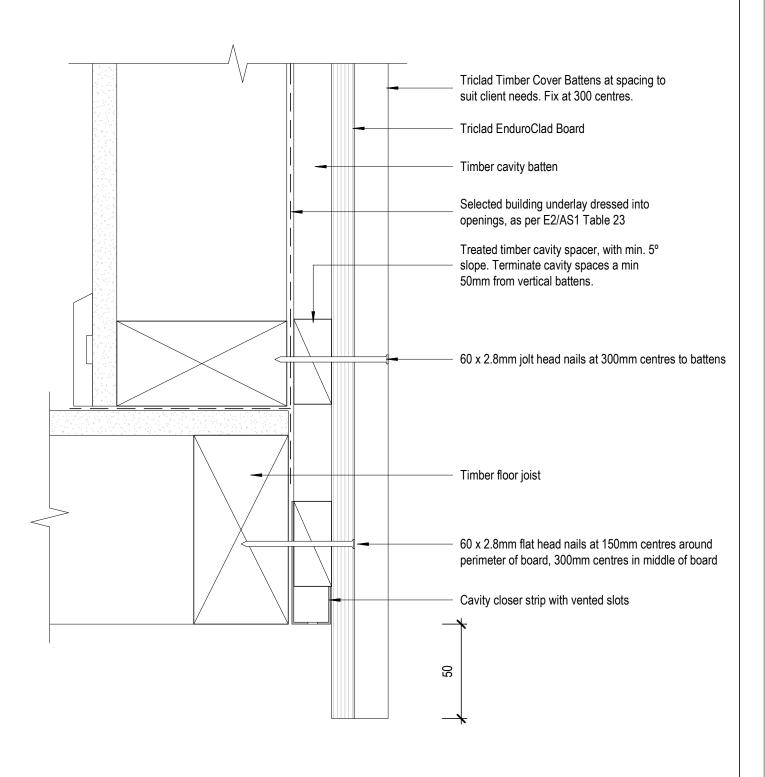




8 Quail Place Hamilton Lake Hamilton New Zealand

Cavity Fix Base Detail-Timber Floor

 1:2@A4
 Dec 2019
 Fig 4

 Scale
 Date
 Dwg

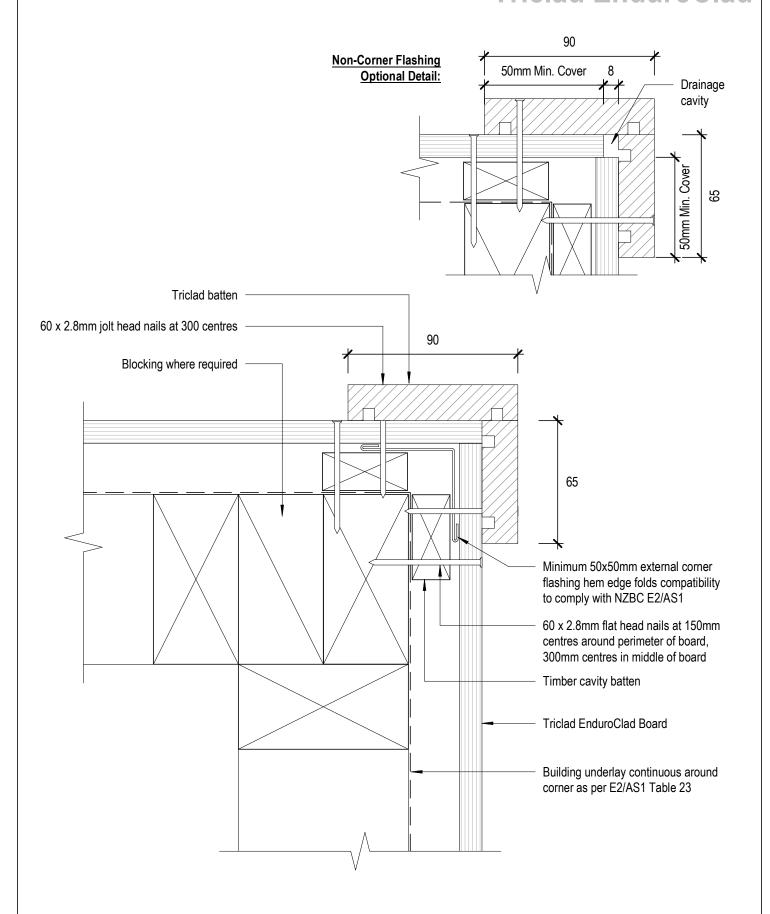




8 Quail Place Hamilton Lake Hamilton New Zealand

Cavity Fix External Corner-Boxed

 1:2@A4
 Dec 2019
 Fig 5

 Scale
 Date
 Dwg

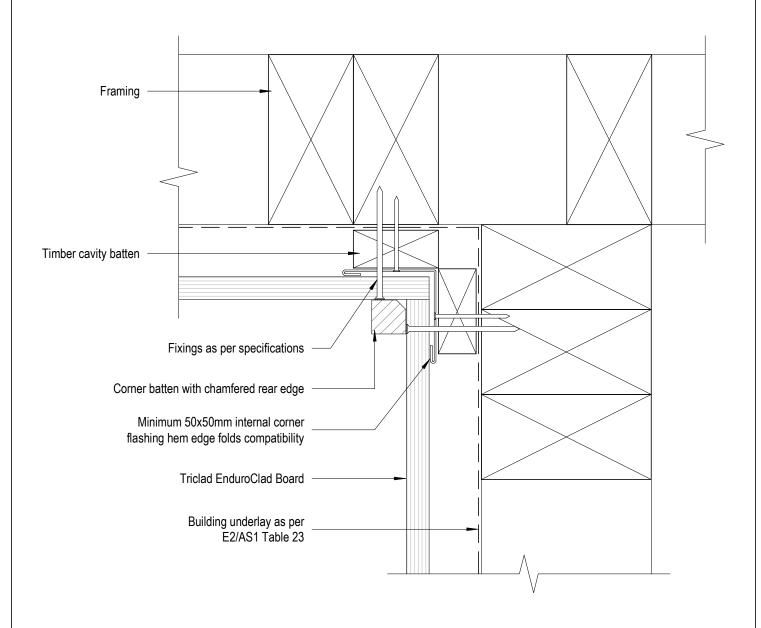




8 Quail Place Hamilton Lake Hamilton New Zealand

Cavity Fix Internal Corner

 1:2@A4
 Dec 2019
 Fig 6

 Scale
 Date
 Dwg

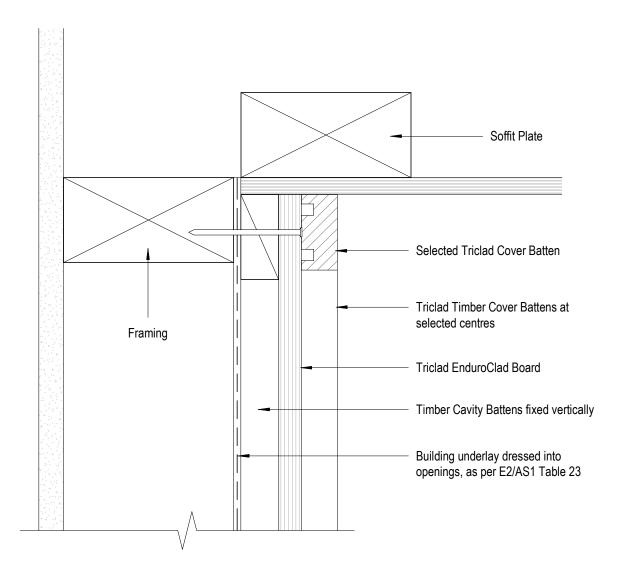




8 Quail Place Hamilton Lake Hamilton New Zealand

Cavity Fix Soffit Detail

 1:2@A4
 Dec 2019
 Fig 7

 Scale
 Date
 Dwg

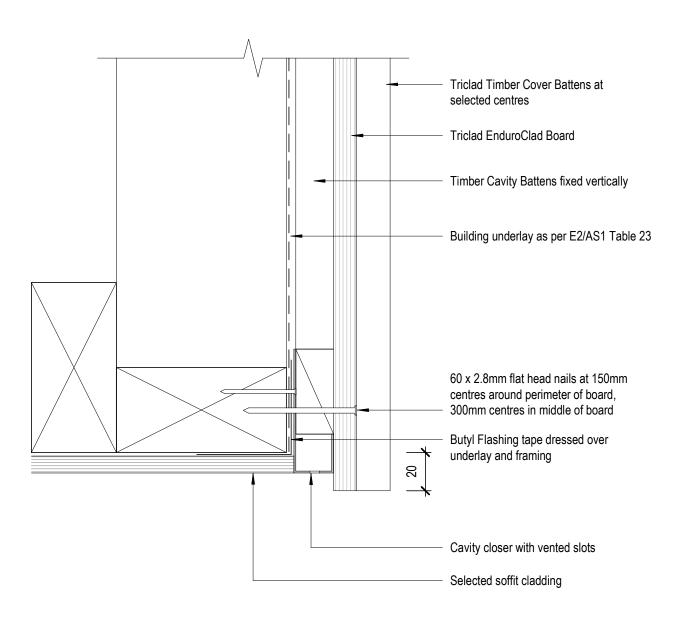




8 Quail Place Hamilton Lake Hamilton New Zealand

Cavity Fix Soffit/Beam Detail

 1:2@A4
 Dec 2019
 Fig 8

 Scale
 Date
 Dwg

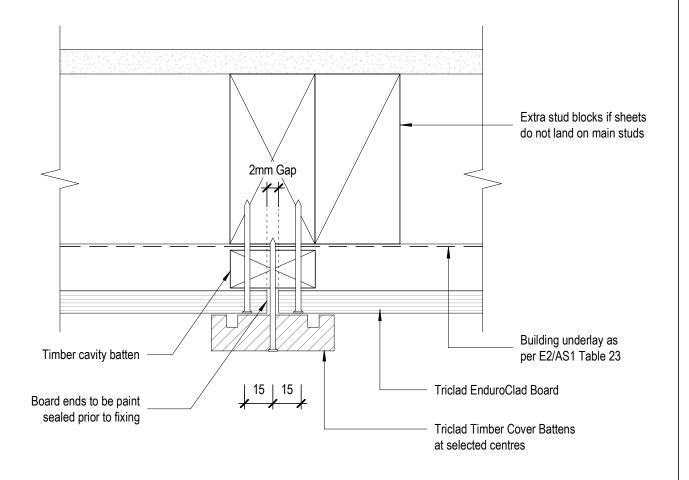




8 Quail Place Hamilton Lake Hamilton New Zealand

Cavity Fix Board Joint Detail

 1:2@A4
 Dec 2019
 Fig 9

 Scale
 Date
 Dwg

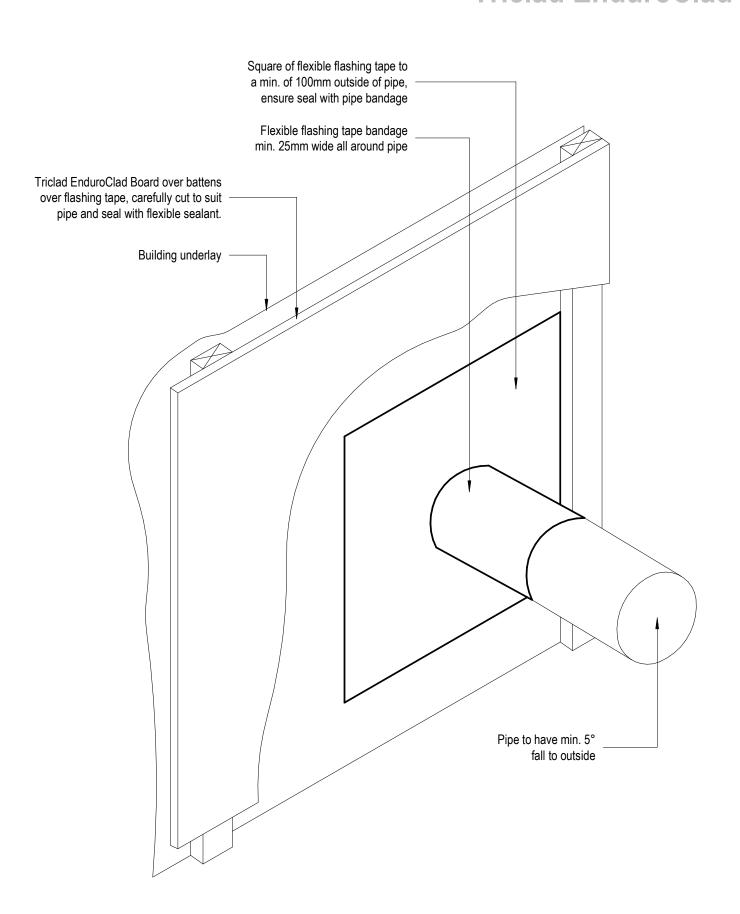




8 Quail Place Hamilton Lake Hamilton New Zealand

Cavity Fix Penetration Detail

 1:5@A4
 Dec 2019
 Fig 10

 Scale
 Date
 Dwg

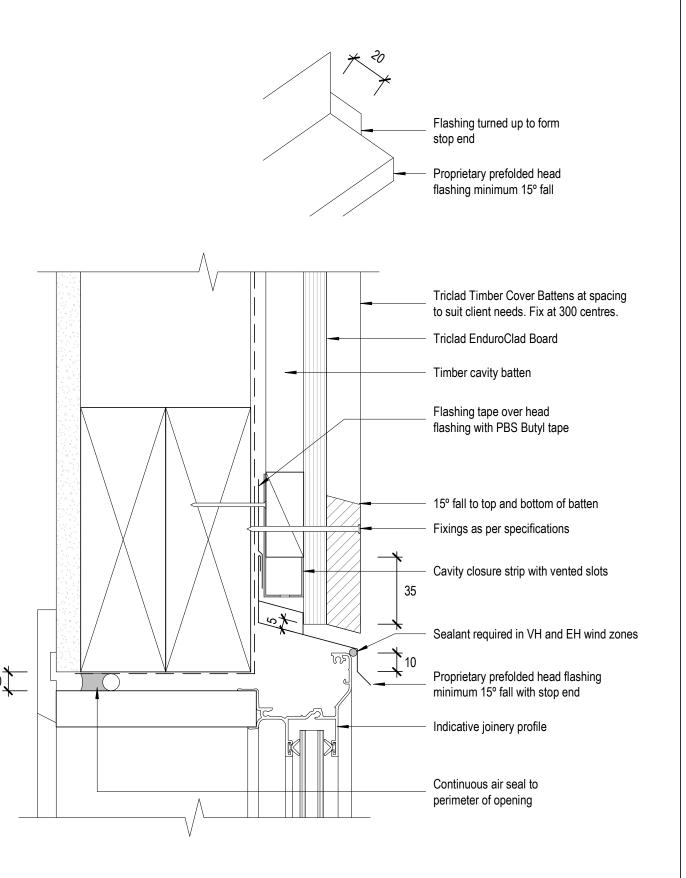




8 Quail Place Hamilton Lake Hamilton New Zealand

Cavity Fix Window Head Detail-Aluminium

 1:2@A4
 Dec 2019
 Fig 11

 Scale
 Date
 Dwg

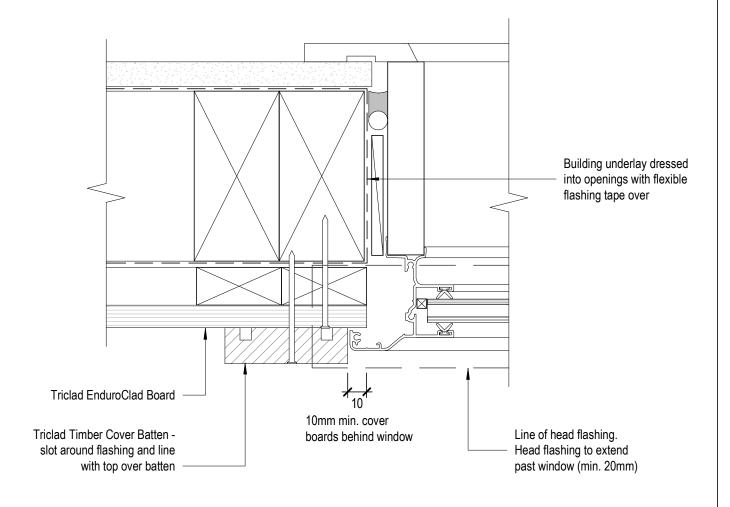



8 Quail Place Hamilton Lake Hamilton New Zealand

Cavity Fix Window Jamb Detail-Aluminium


 1 : 2 @ A4
 Dec 2019
 Fig 12

 Scale
 Date
 Dwg

T. 0800 874 2523

E. sales@triclad.co.nz

www.triclad.co.nz

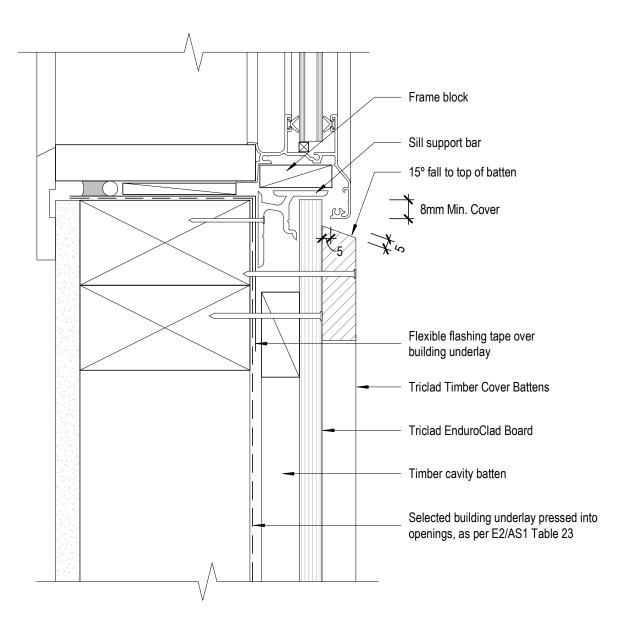




8 Quail Place Hamilton Lake Hamilton New Zealand

Cavity Fix Window Sill Detail-Aluminium

 1:2@A4
 Dec 2019
 Fig 13

 Scale
 Date
 Dwg

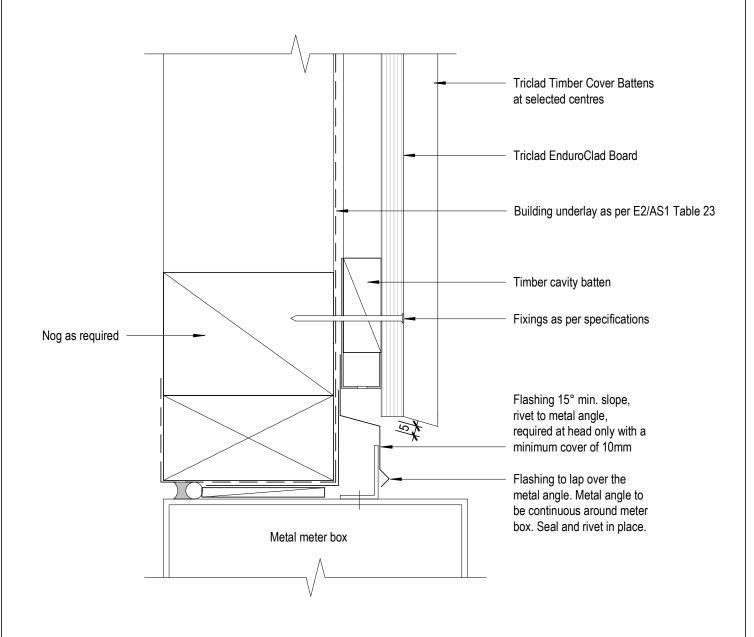




8 Quail Place Hamilton Lake Hamilton New Zealand

Cavity Fix Meter Box Head

Fig 14 Dwg

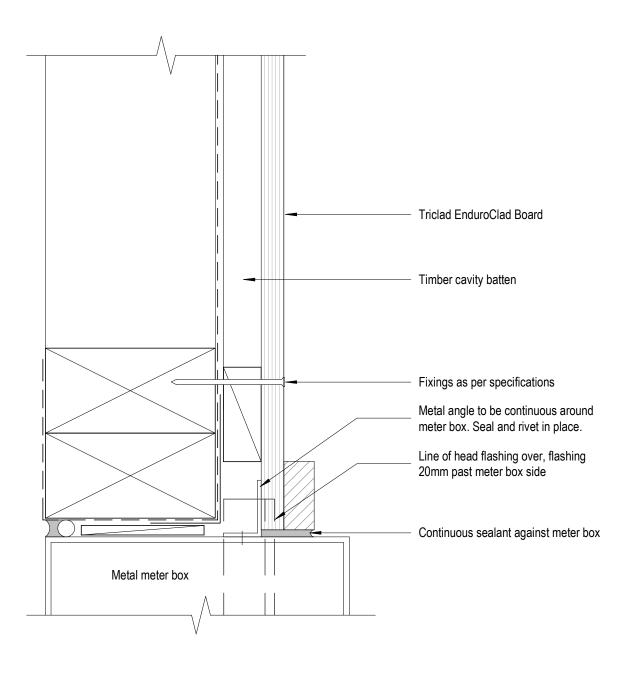




8 Quail Place Hamilton Lake Hamilton New Zealand

Cavity Fix Meter Box Jamb

 1 : 2 @ A4
 Dec 2019
 Fig 15

 Scale
 Date
 Dwg

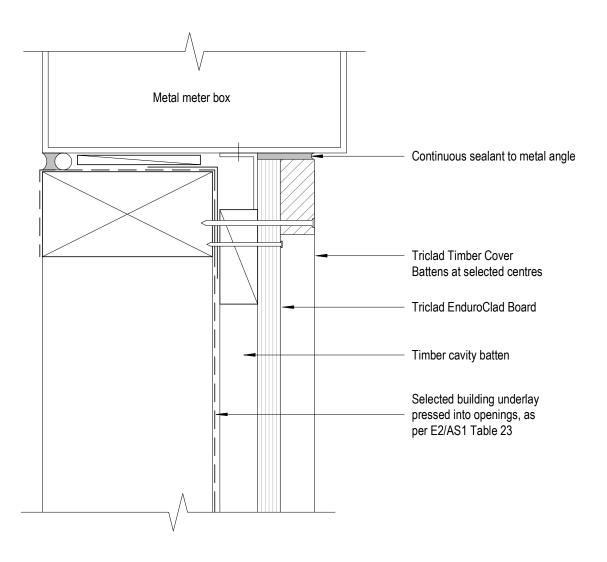



8 Quail Place Hamilton Lake Hamilton New Zealand

Cavity Fix Meter Box Sill

1:2 @ A4 Dec 2019
Scale Date

Fig 16

Dwg

Triclad EnduroClad Triclad Timber Cover Battens at selected centres Triclad EnduroClad Board Timber cavity batten Flashing leg above base of of board. Refer to E2/AS1 Table 7 Selected building underlay dressed into openings, as per E2/AS1 Table 23 Flashing tape over head flashing or additional layer of building underlay lapped over flashing 75 Cavity closer strip Refer Figure 7 and Table 7 of E2/AS1 document Selected roofing with stop end 8 Quail Place




8 Quail Place Hamilton Lake Hamilton New Zealand

Cavity Fix Roof/Wall Detail

Dec 2019

Date

1:2@A4 Scale Fig 17 Dwg

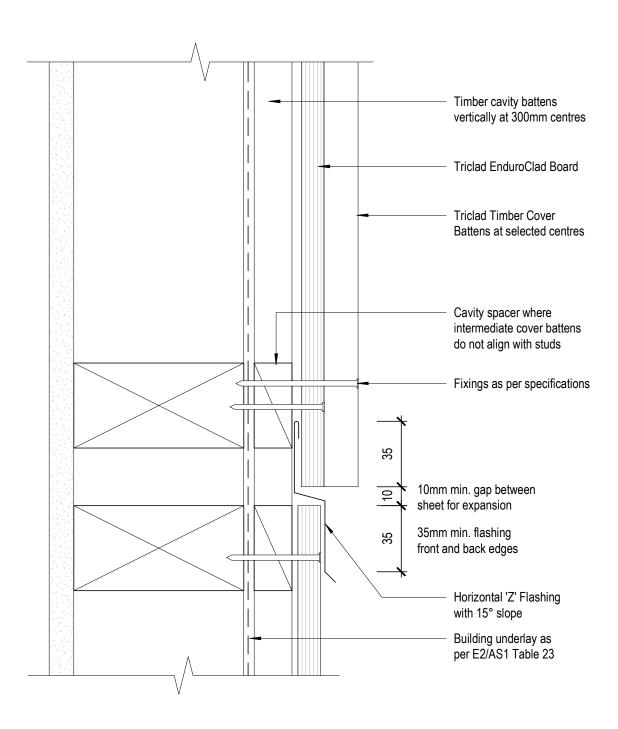




8 Quail Place Hamilton Lake Hamilton New Zealand

Cavity Fix Horizontal Join Detail

 1 : 2 @ A4
 Dec 2019
 Fig 18

 Scale
 Date
 Dwg

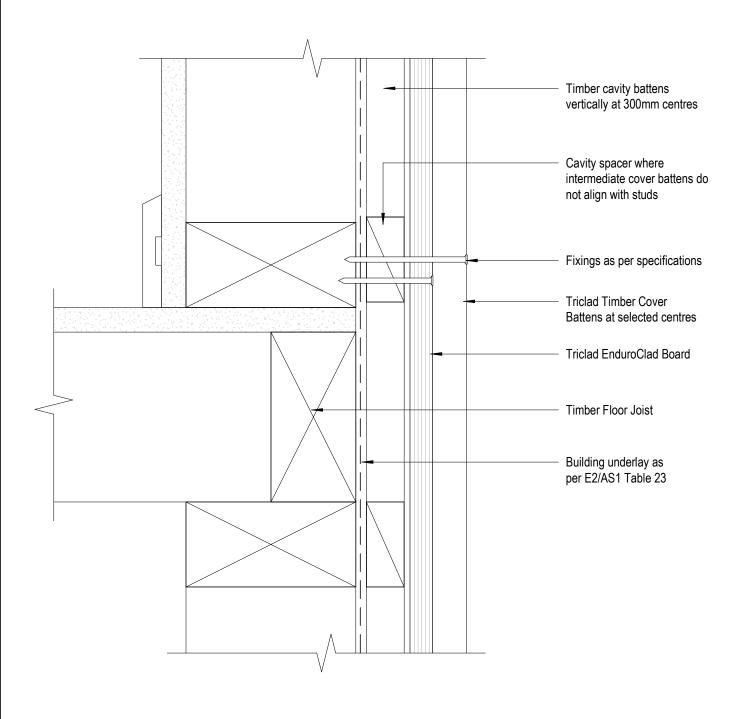




8 Quail Place Hamilton Lake Hamilton New Zealand

Cavity Fix Inter-Story Detail - No Join

1:2@A4 Scale

Dec 2019 Date **Fig 18a** Dwg

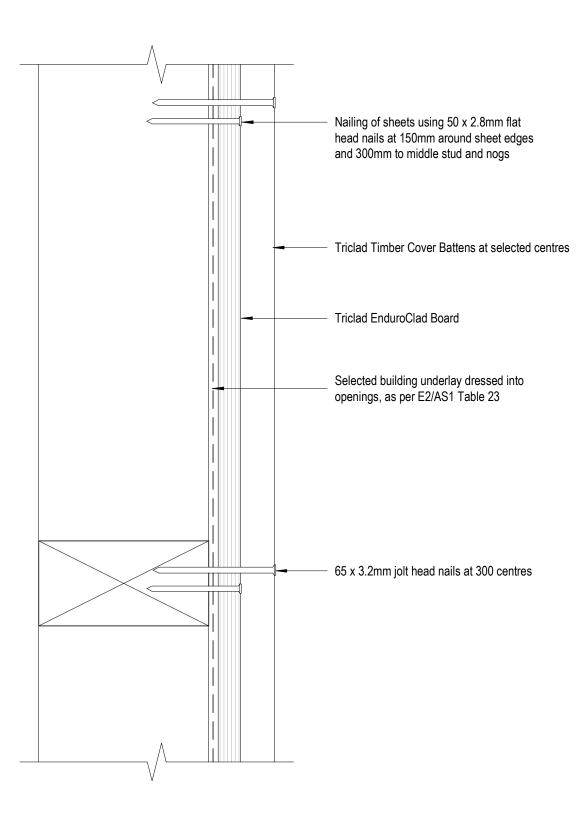




8 Quail Place Hamilton Lake Hamilton New Zealand

Direct Fix Nailing Setout

 1 : 2 @ A4
 Dec 2019
 Fig 19

 Scale
 Date
 Dwg

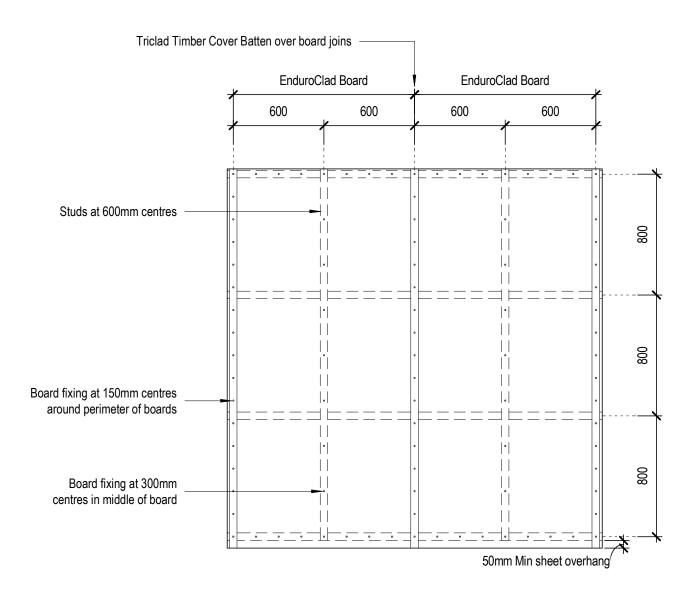

NOTE:

Where cover battens do not sit over a stud it is recommended that additional nogging is used to provide additional fixing for the decorative cover battens.




8 Quail Place Hamilton Lake Hamilton New Zealand

Direct Fix Framing/Batten Setout

 1:25@A4
 Dec 2019
 Fig 20

 Scale
 Date
 Dwg

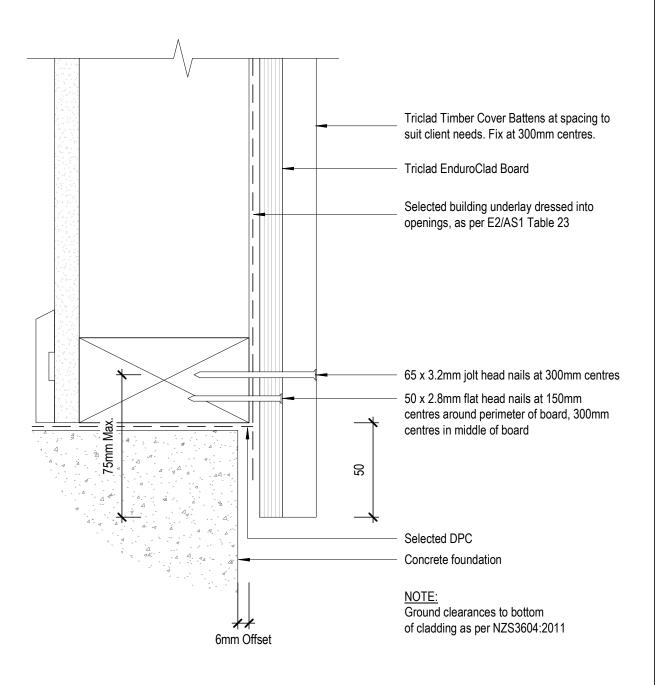




8 Quail Place Hamilton Lake Hamilton New Zealand

Direct Fix Base Detail-Concrete Floor

 1 : 2 @ A4
 Dec 2019
 Fig 21

 Scale
 Date
 Dwg

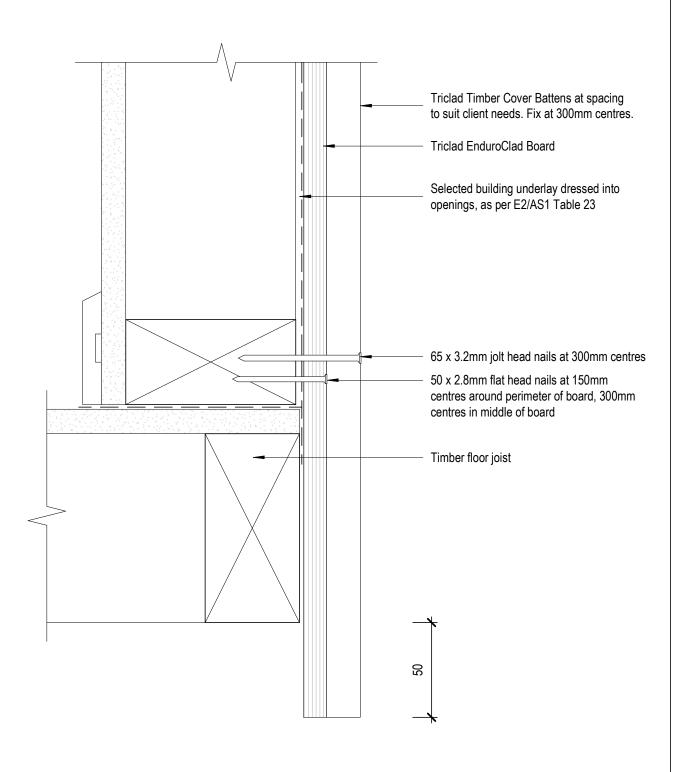




8 Quail Place Hamilton Lake Hamilton New Zealand

Direct Fix Base Detail-Timber Floor

 1:2@A4
 Dec 2019
 Fig 22

 Scale
 Date
 Dwg

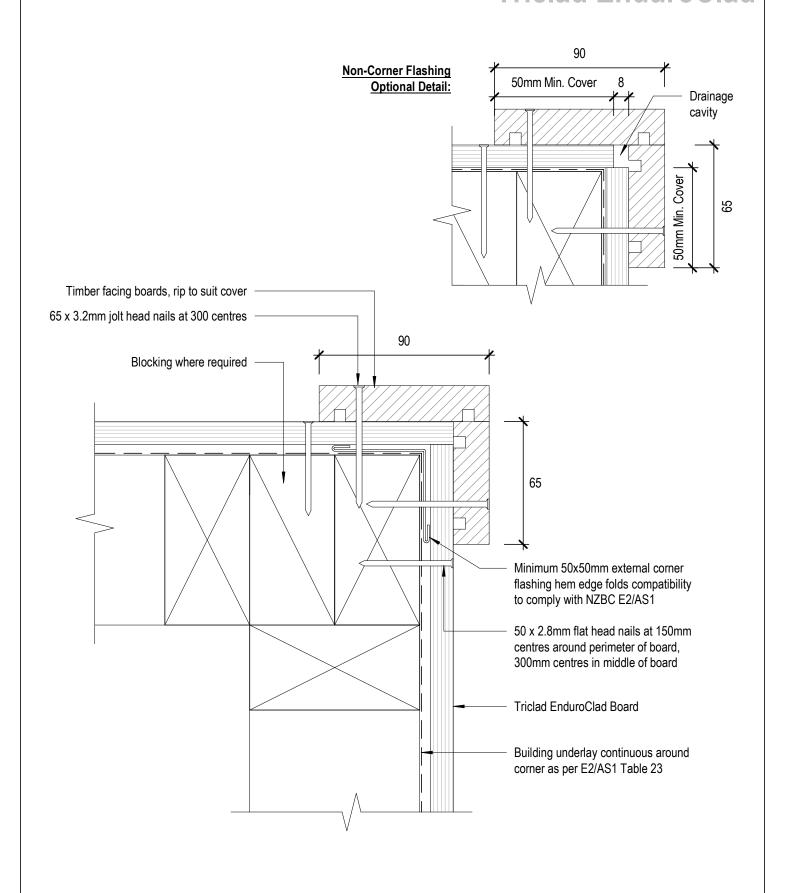




8 Quail Place Hamilton Lake Hamilton New Zealand

Direct Fix External Corner-Boxed

 1:2@A4
 Dec 2019
 Fig 23

 Scale
 Date
 Dwg

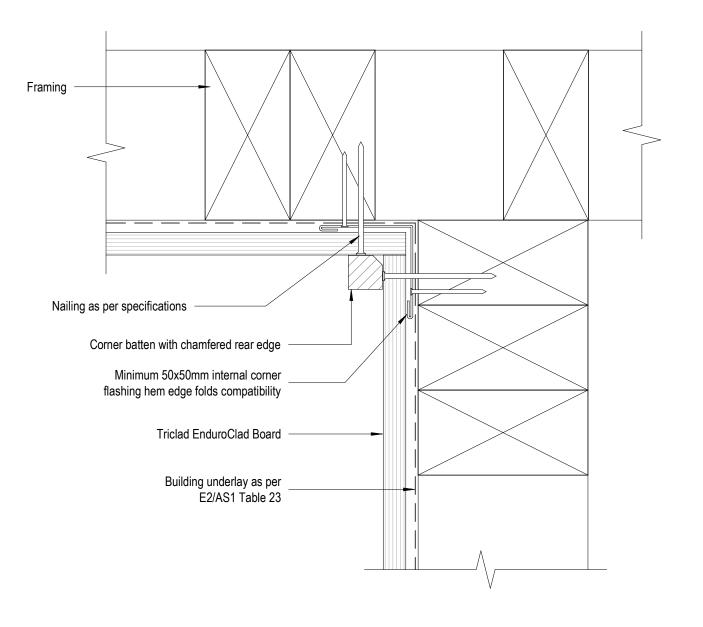




8 Quail Place Hamilton Lake Hamilton New Zealand

Direct Fix Internal Corner

1:2@A4 Dec 2019 Fig 24 Scale Date Dwg

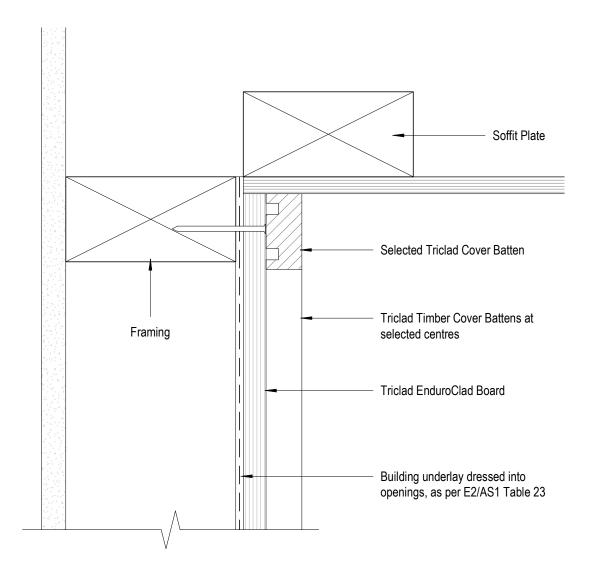




8 Quail Place Hamilton Lake Hamilton New Zealand

Direct Fix Soffit Detail

1:2@A4 Dec 2019 Scale Date Fig 25 Dwg

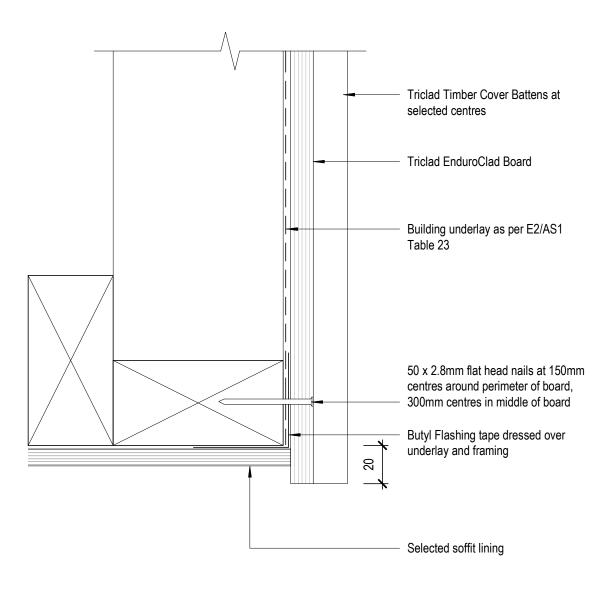




8 Quail Place Hamilton Lake Hamilton New Zealand

Direct Fix Soffit/Beam Detail

 1:2@A4
 Dec 2019
 Fig 26

 Scale
 Date
 Dwg

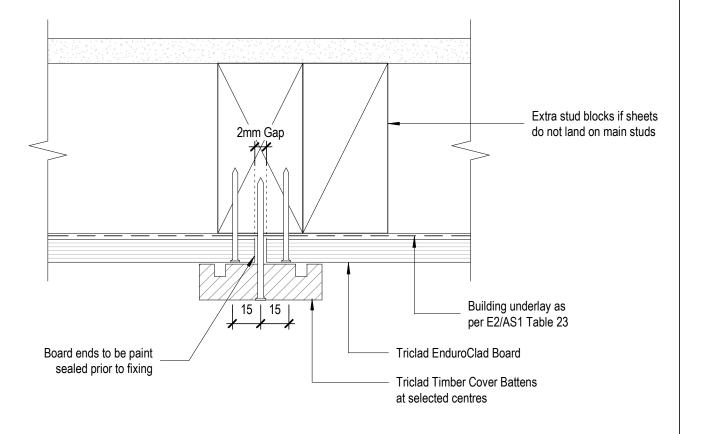




8 Quail Place Hamilton Lake Hamilton New Zealand

Direct Fix Board Joint Detail

 1 : 2 @ A4
 Dec 2019
 Fig 27

 Scale
 Date
 Dwg

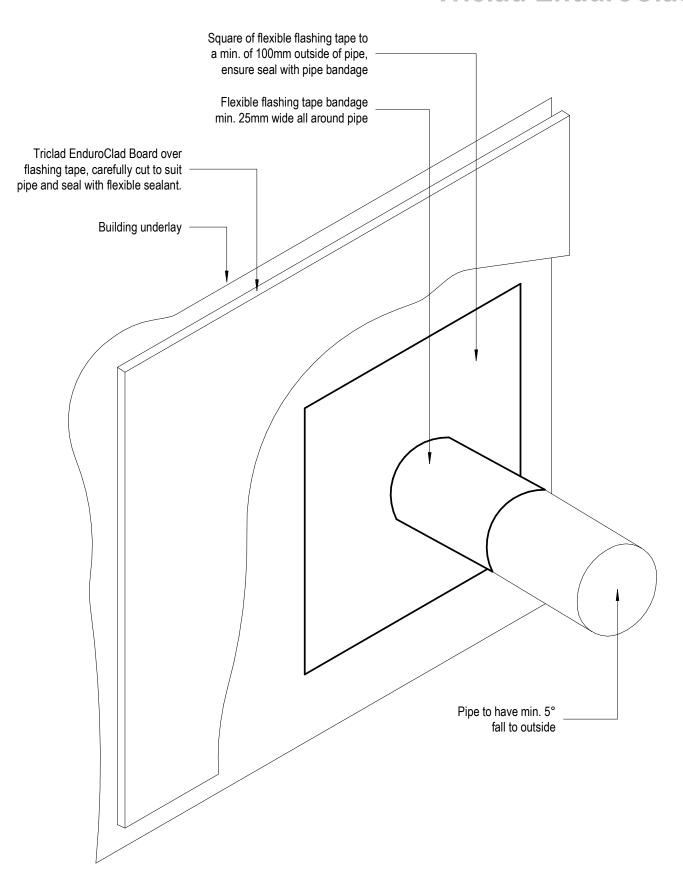




8 Quail Place Hamilton Lake Hamilton New Zealand

Direct Fix Penetration Detail

 1:5@A4
 Dec 2019
 Fig 28

 Scale
 Date
 Dwg

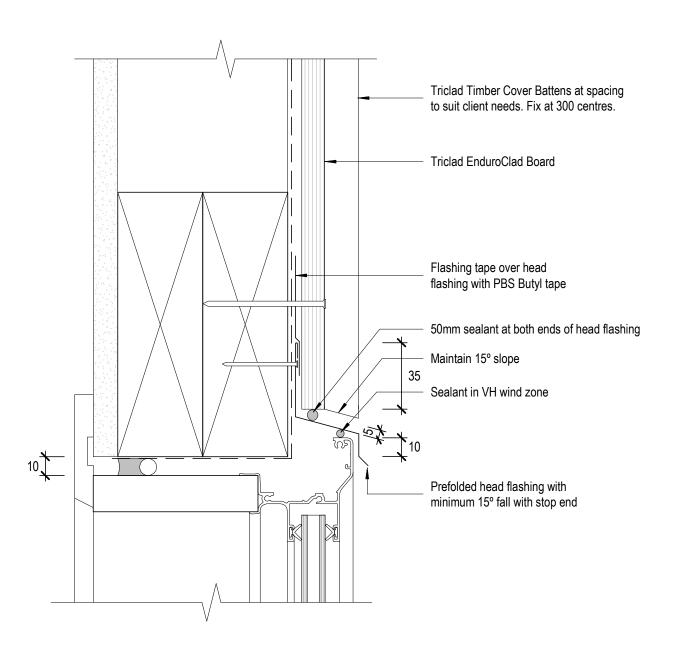




8 Quail Place Hamilton Lake Hamilton New Zealand

Direct Fix Window Head Detail-Aluminium

 1 : 2 @ A4
 Dec 2019
 Fig 29

 Scale
 Date
 Dwg

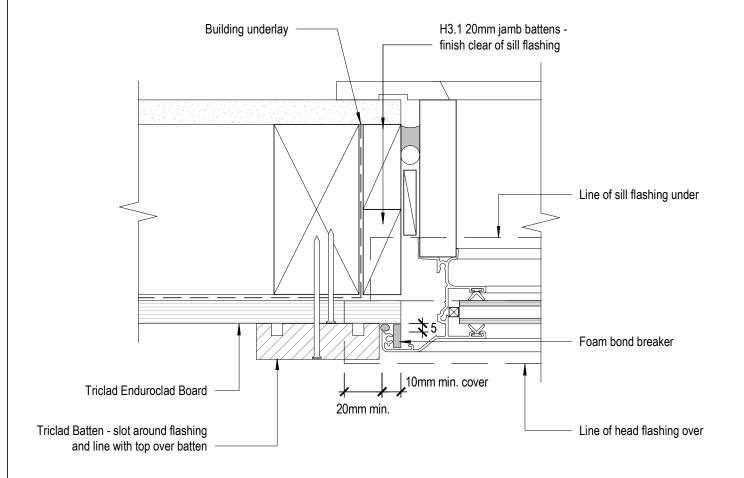




8 Quail Place Hamilton Lake Hamilton New Zealand

Direct Fix Window Jamb Detail-Aluminium

 1:2@A4
 Dec 2019
 Fig 30

 Scale
 Date
 Dwg

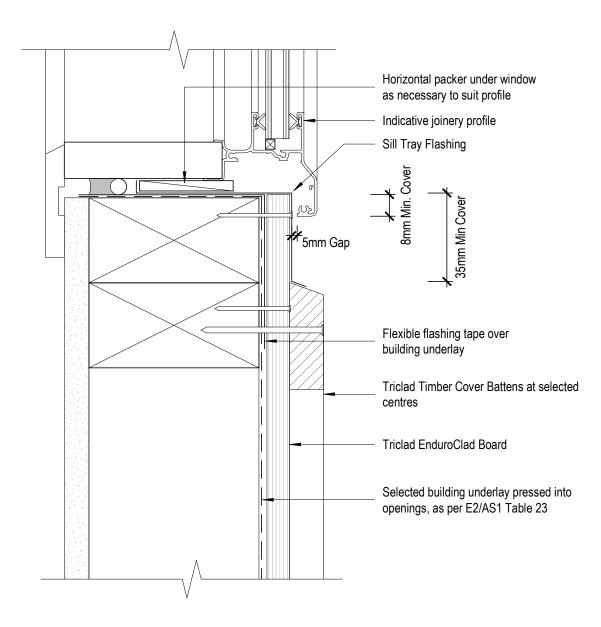




8 Quail Place Hamilton Lake Hamilton New Zealand

Direct Fix Window Sill Detail-Aluminium

 1:2@A4
 Dec 2019
 Fig 31

 Scale
 Date
 Dwg

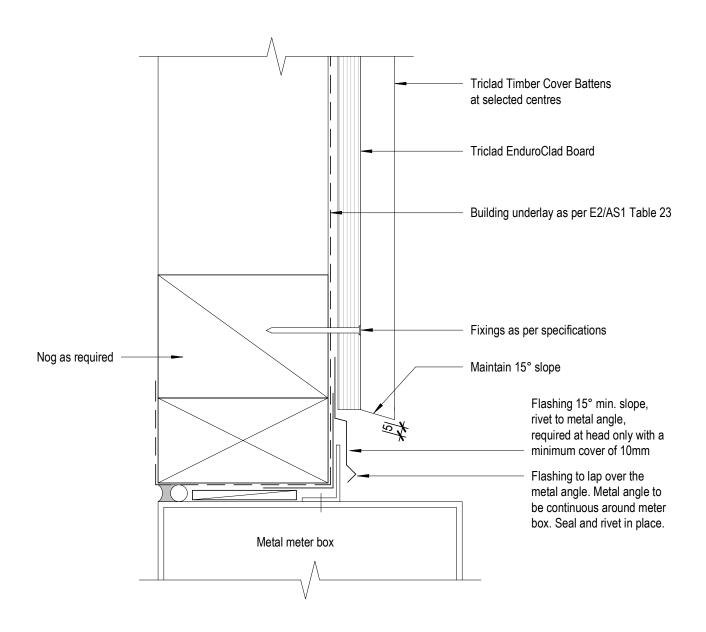




8 Quail Place Hamilton Lake Hamilton New Zealand

Direct Fix Meter Box Head

 1:2@A4
 Dec 2019
 Fig 32

 Scale
 Date
 Dwg

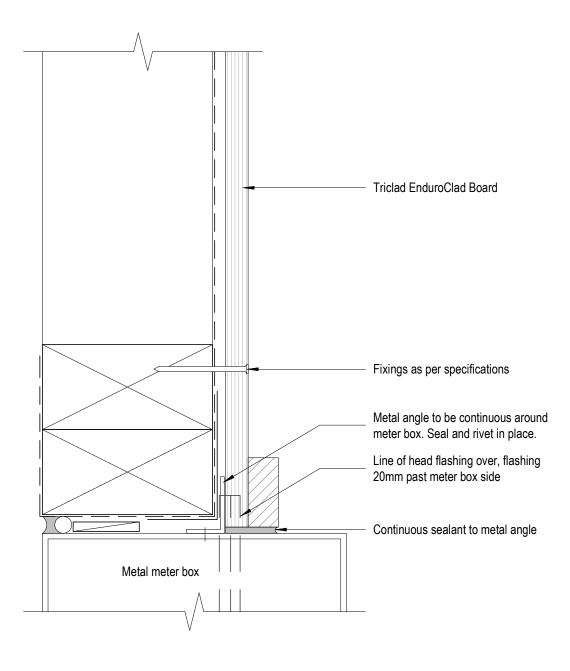




8 Quail Place Hamilton Lake Hamilton New Zealand

Direct Fix Meter Box Jamb

 1:2@A4
 Dec 2019
 Fig 33

 Scale
 Date
 Dwg

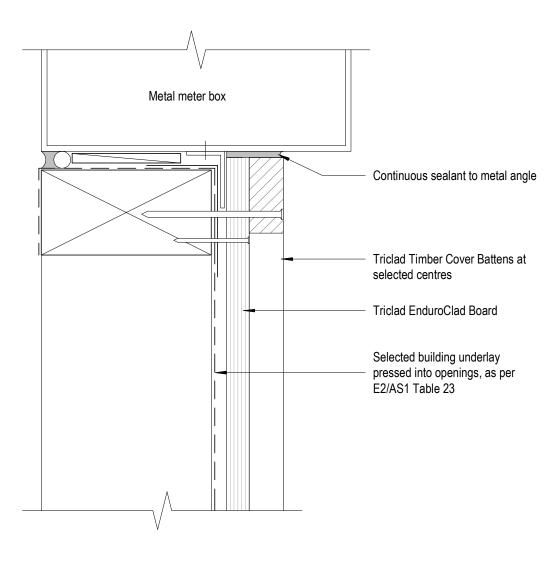



8 Quail Place Hamilton Lake Hamilton New Zealand

Direct Fix Meter Box Sill

1:2@A4 Dec 2019 Scale Date

Fig 34

Dwg


Triclad EnduroClad Triclad Timber Cover Battens at spacing to suit client needs. Fix at 300 centres. Triclad EnduroClad Board Flashing leg above base of of board. Refer to E2/AS1 Table 7 Selected building underlay dressed into openings, as per E2/AS1 Table 23 Flashing tape over head flashing or additional layer of building underlay lapped over flashing 75 Refer Figure 7 and Table 7 of E2/AS1 document



8 Quail Place Hamilton Lake Hamilton New Zealand

Direct Fix Roof/Wall Detail

1:2@A4 Scale Dec 2019 Date **Fig 35** Dwg

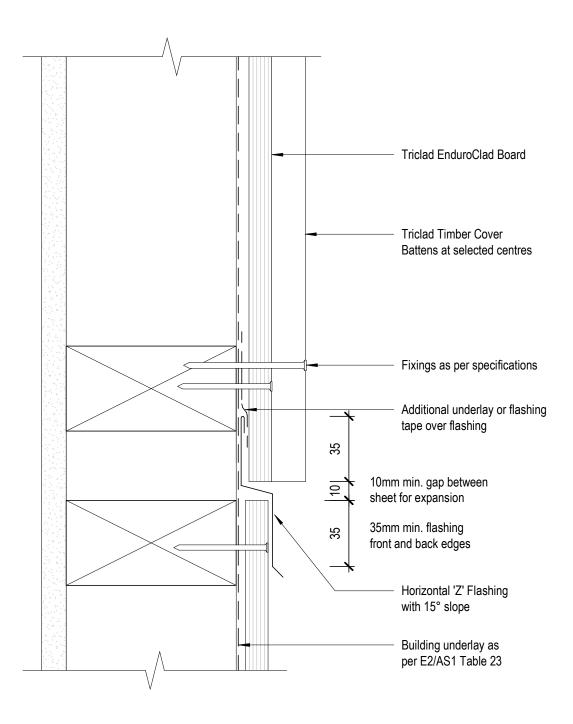




8 Quail Place Hamilton Lake Hamilton New Zealand

Direct Fix Horizontal Join Detail

 1:2@A4
 Dec 2019
 Fig 36

 Scale
 Date
 Dwg

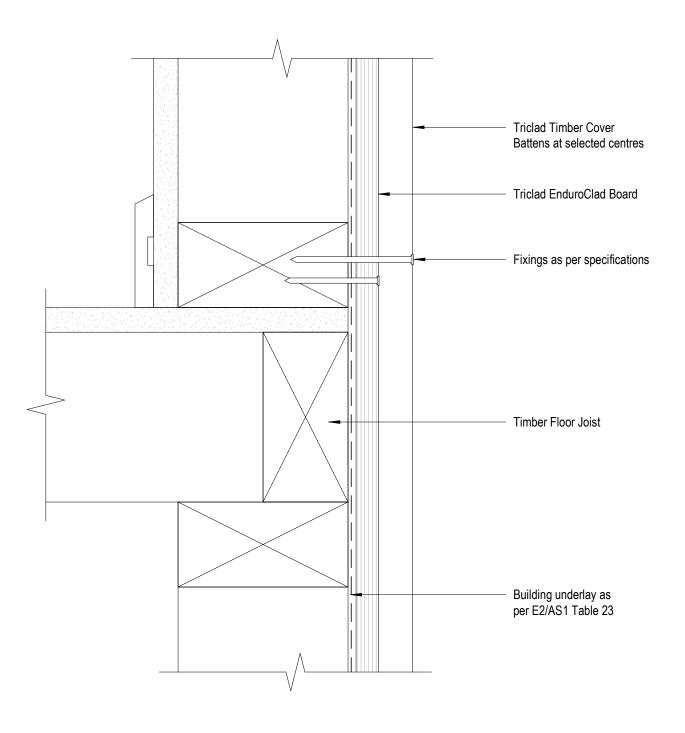



8 Quail Place Hamilton Lake Hamilton New Zealand

Direct Fix Inter-Story Detail - No Join

1:2@A4 Scale

Dec 2019 Date **Fig 36a** Dwg