




8 Quail Place Hamilton Lake Hamilton New Zealand

Cavity Fix Nailing Setout Detail

 1:2@A4
 Sept 2019
 Fig 1

 Scale
 Date
 Dwg

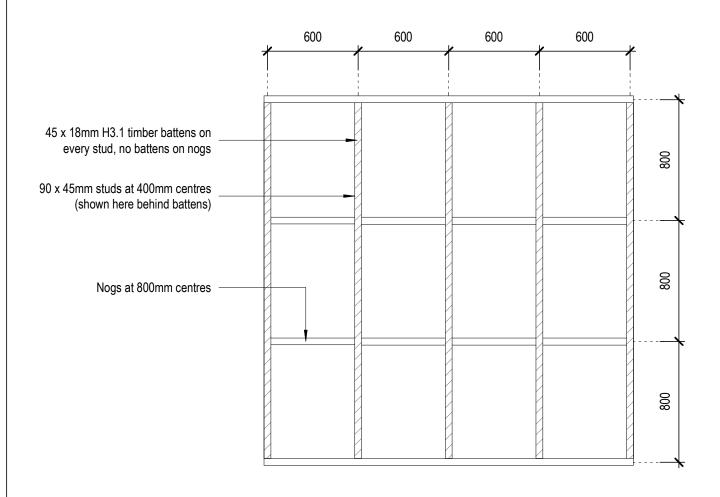




8 Quail Place Hamilton Lake Hamilton New Zealand

Cavity Fix Framing/Batten Setout

1:25 @ A4 Scale Sept 2019 Fig 2
Date Dwg

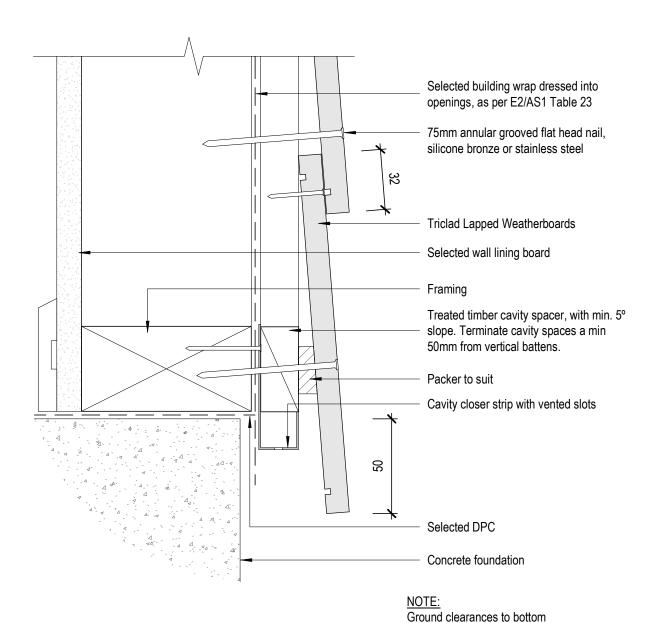




8 Quail Place Hamilton Lake Hamilton New Zealand

Cavity Fix Base Detail-Concrete Floor

of cladding as per NZS3604:2011

1:2@A4 Scale Sept 2019 Date Fig 3 Dwg

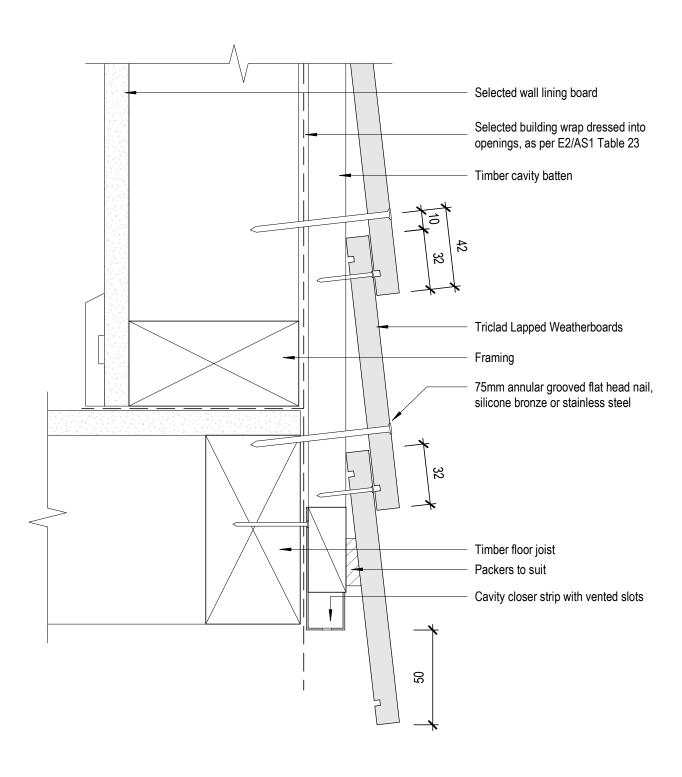




8 Quail Place Hamilton Lake Hamilton New Zealand

Cavity Fix Base Detail-Timber Floor

 1:2@A4
 Sept 2019
 Fig 4

 Scale
 Date
 Dwg

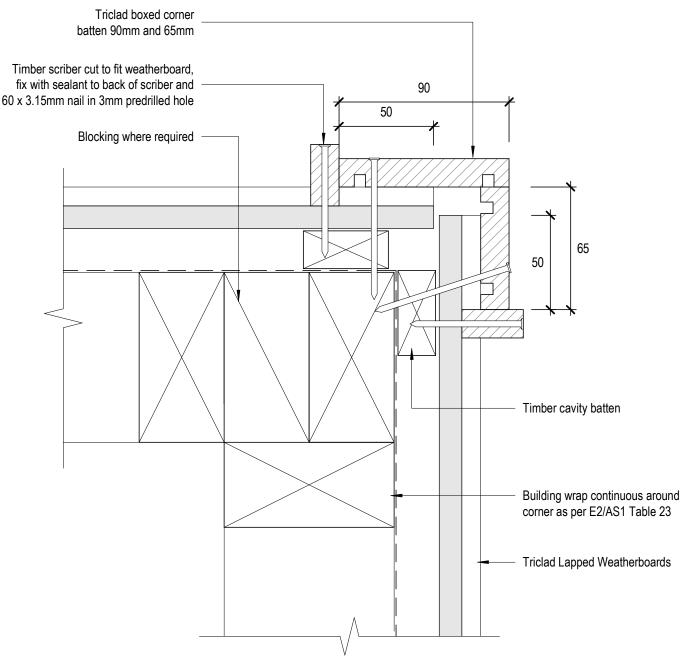

NOTE:
Box corner trim must not be continuous over solid floor joists.




8 Quail Place Hamilton Lake Hamilton New Zealand

Cavity Fix External Corner-Boxed

Date

Sept 2019

1:2@A4 Scale Fig 5 Dwg

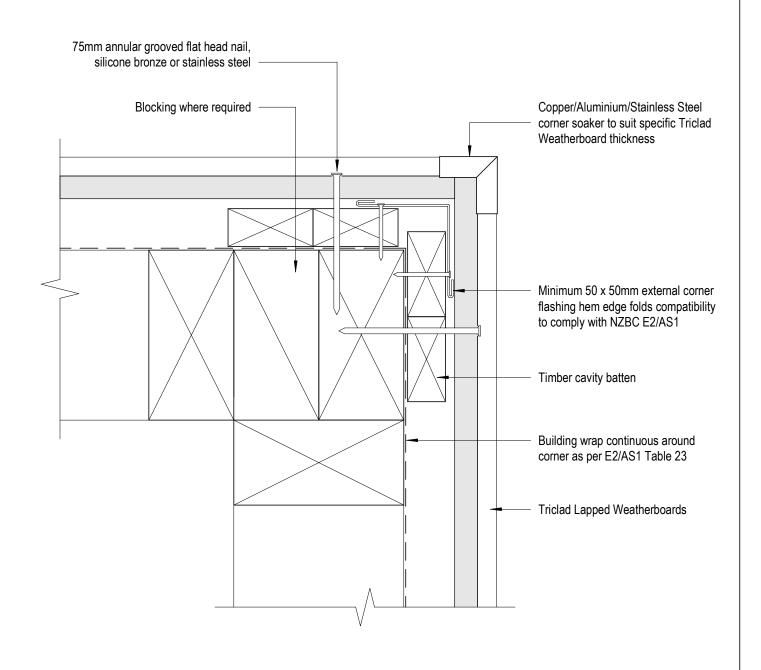




8 Quail Place Hamilton Lake Hamilton New Zealand

Cavity Fix External Corner-Soaker

1:2@A4 Scale Sept 2019 Date Fig 6 Dwg

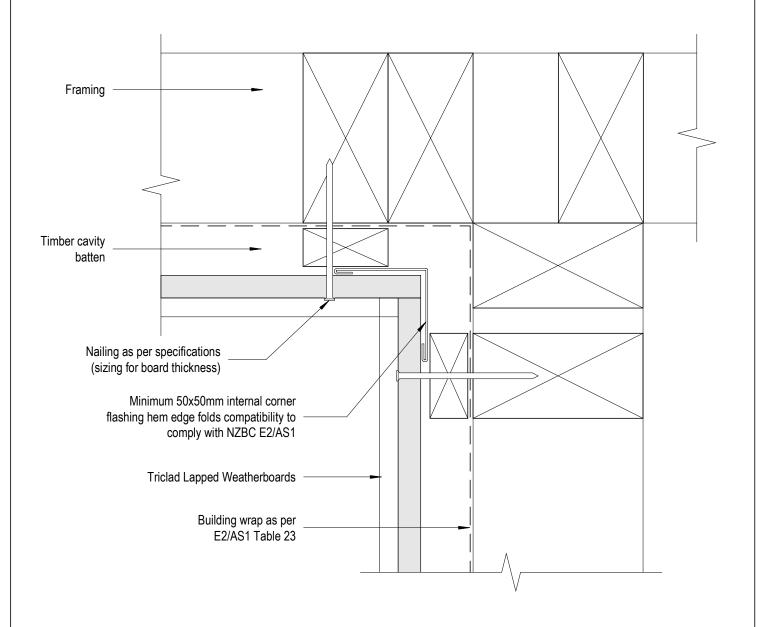



8 Quail Place Hamilton Lake Hamilton New Zealand


Cavity Fix Internal Corner-Option 1

1:2@A4 Scale Sept 2019 Fig 7
Date Dwg

T. 0800 874 2523

E. sales@triclad.co.nz

www.triclad.co.nz

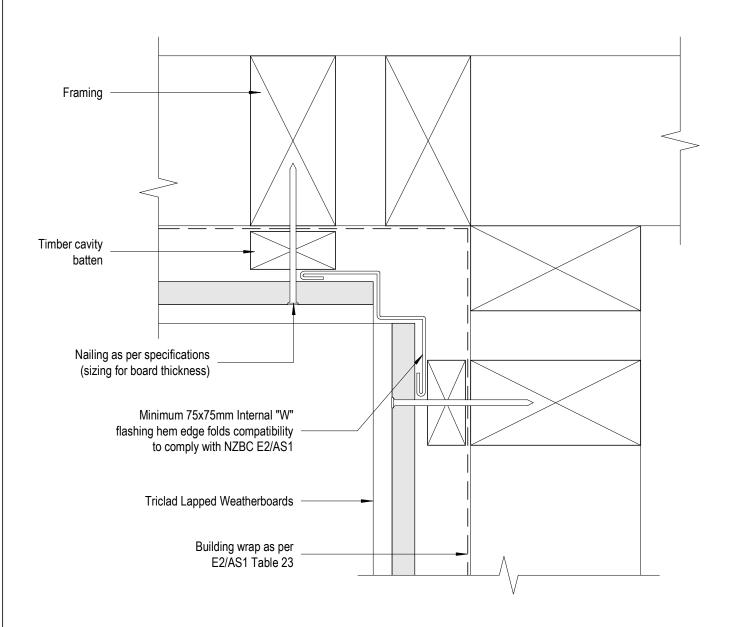



8 Quail Place Hamilton Lake Hamilton New Zealand

Cavity Fix Internal Corner-Option 2


1:2@A4 Scale Sept 2019 Date Fig 8

Dwg

T. 0800 874 2523

E. sales@triclad.co.nz

www.triclad.co.nz

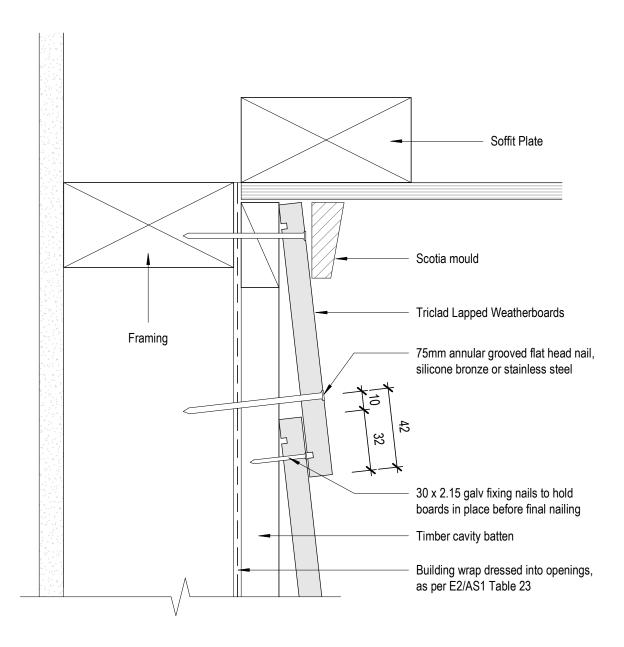



T. 0800 874 2523

8 Quail Place Hamilton Lake Hamilton New Zealand


Cavity Fix Soffit Detail

1:2@A4 Scale Sept 2019 Date Fig 9

Dwg

E. sales@triclad.co.nz

www.triclad.co.nz

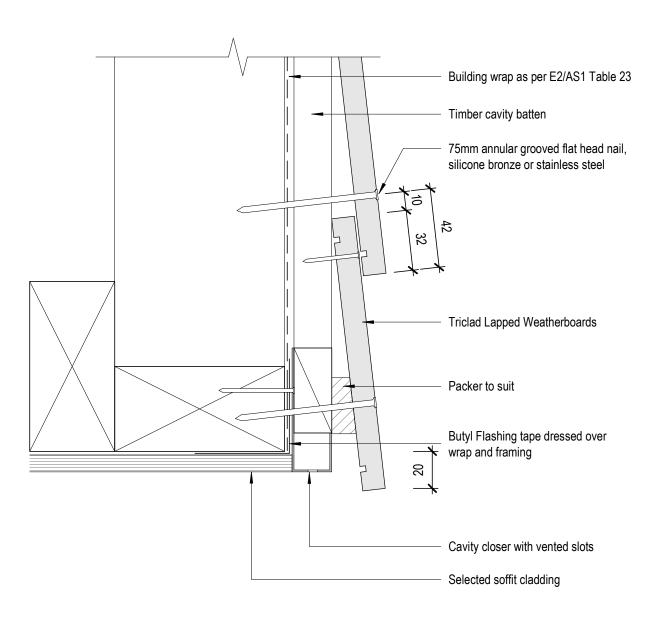




8 Quail Place Hamilton Lake Hamilton New Zealand

Cavity Fix Soffit/Beam Detail

1:2@A4 Scale Sept 2019 Date Fig 10 Dwg

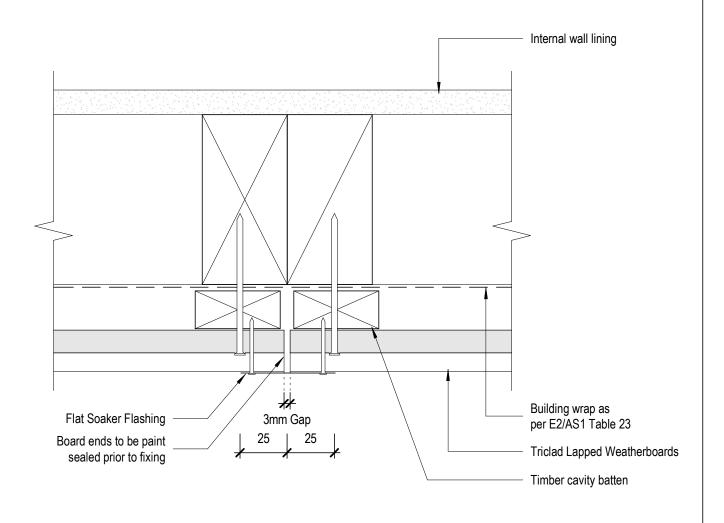




8 Quail Place Hamilton Lake Hamilton New Zealand

Cavity Fix Board Joint Detail

1:2@A4 Scale Sept 2019 Date **Fig 11** Dwg

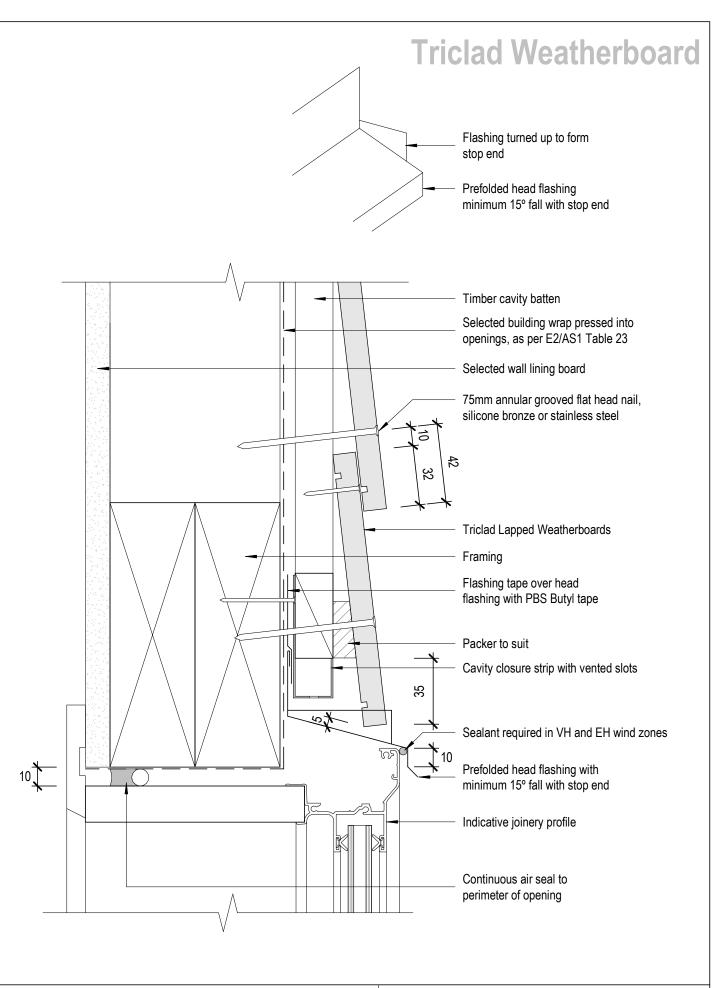




8 Quail Place Hamilton Lake Hamilton New Zealand

Cavity Fix Window Head Detail-Aluminium

 1:2@A4
 Sept 2019
 Fig 12

 Scale
 Date
 Dwg

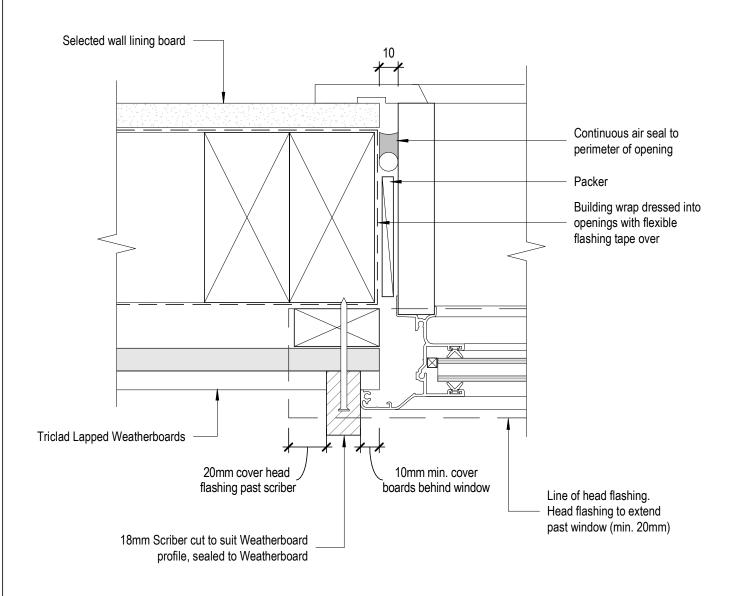




8 Quail Place Hamilton Lake Hamilton New Zealand

Cavity Fix Window Jamb Detail-Aluminium

Date

1:2@A4 Scale

Sept 2019 Fig 13 Dwg

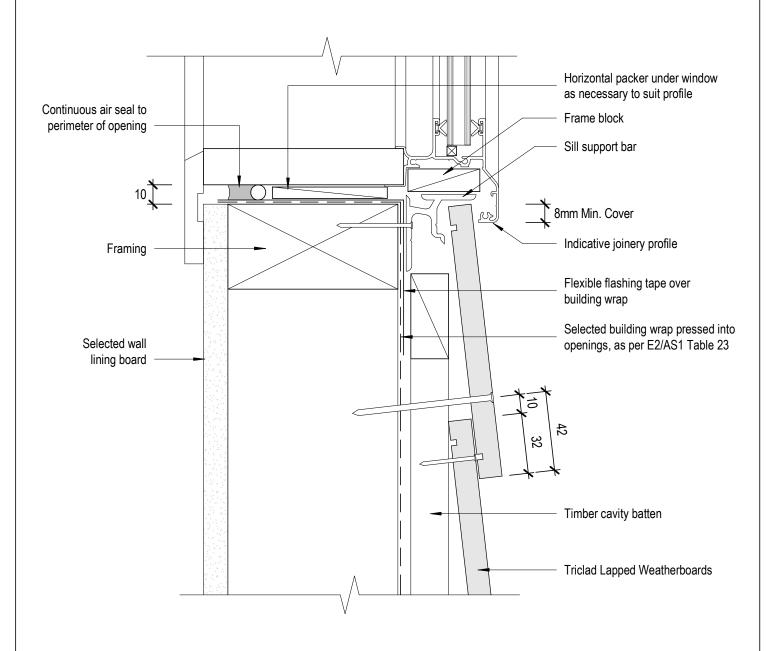




8 Quail Place Hamilton Lake Hamilton New Zealand

Cavity Fix Window Sill Detail-Aluminium

1:2@A4 Scale Sept 2019 Date

Fig 14 Dwg

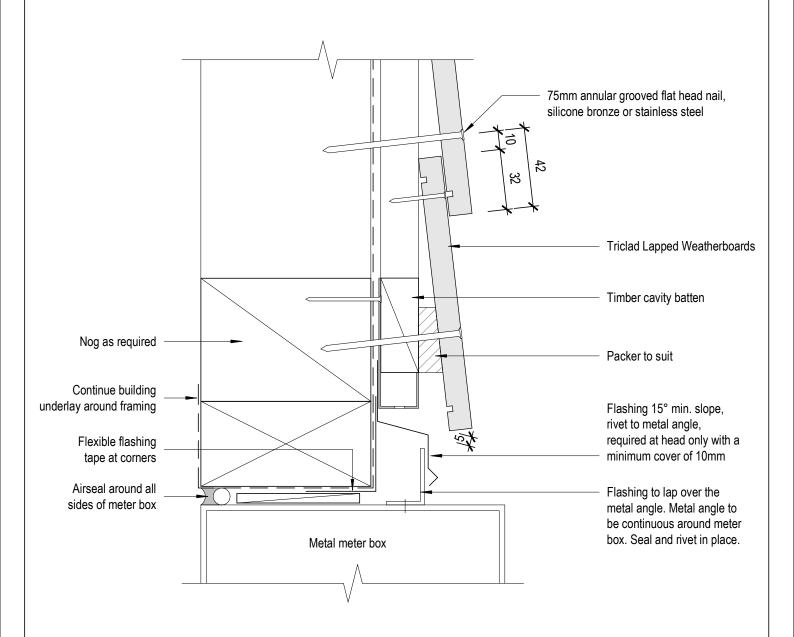




8 Quail Place Hamilton Lake Hamilton New Zealand

Cavity Fix Meter Box Head

1:2@A4 Scale

Sept 2019 Date Fig 15 Dwg

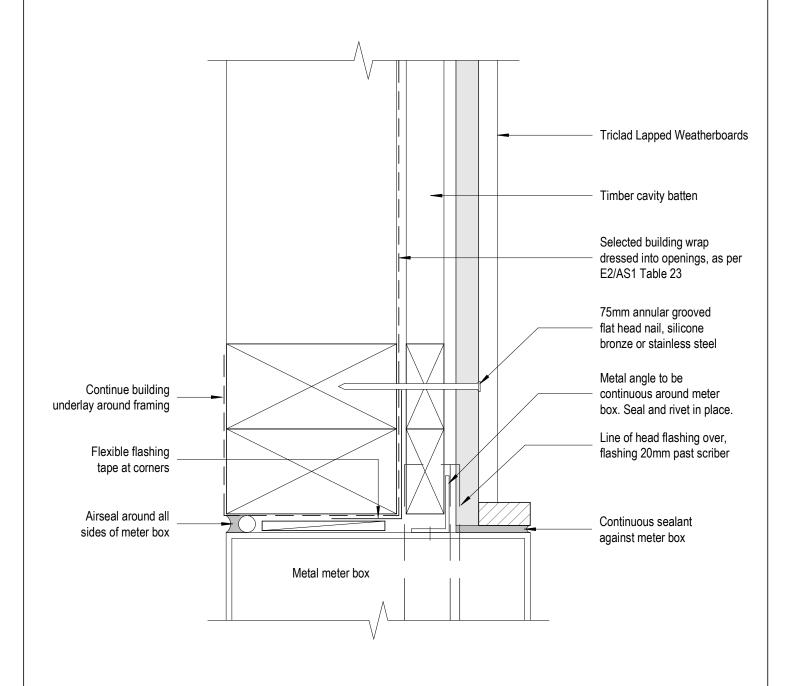




8 Quail Place Hamilton Lake Hamilton New Zealand

Cavity Fix Meter Box Jamb

1:2@A4 Scale

Sept 2019 Date

Fig 16 Dwg

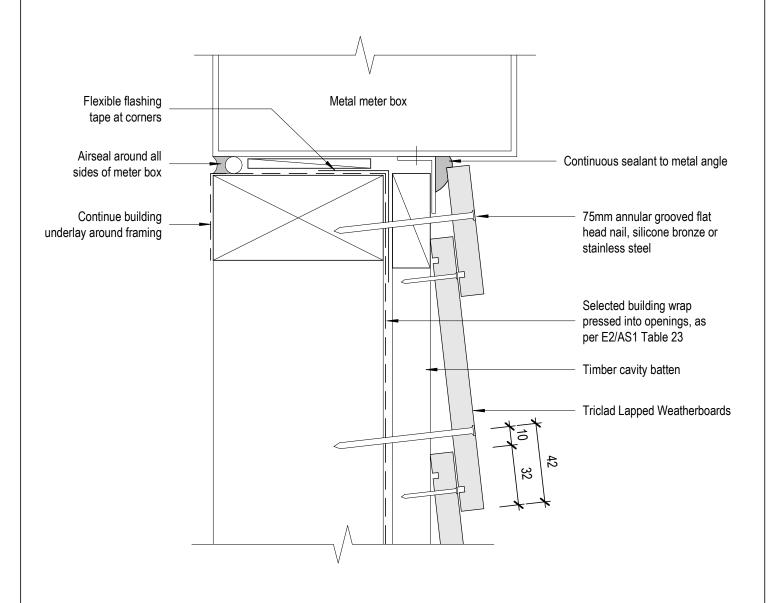




8 Quail Place Hamilton Lake Hamilton New Zealand

Cavity Fix Meter Box Sill

1:2@A4 Scale Sept 2019 Date

Fig 17

Dwg

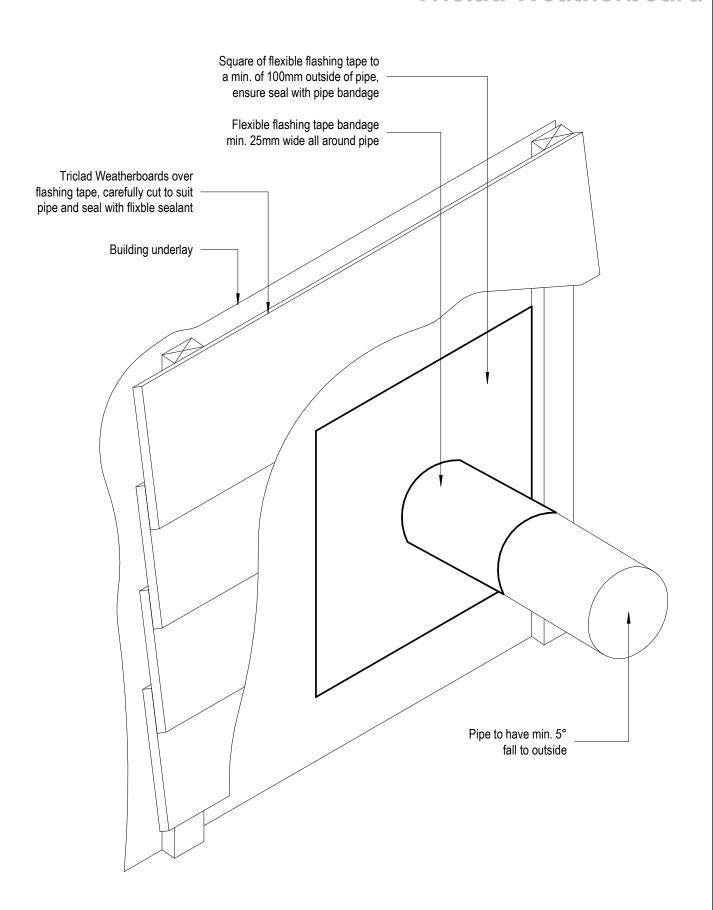




8 Quail Place Hamilton Lake Hamilton New Zealand

Cavity Fix Penetration Detail

1:5@A4 Scale Sept 2019 Date Fig 18 Dwg

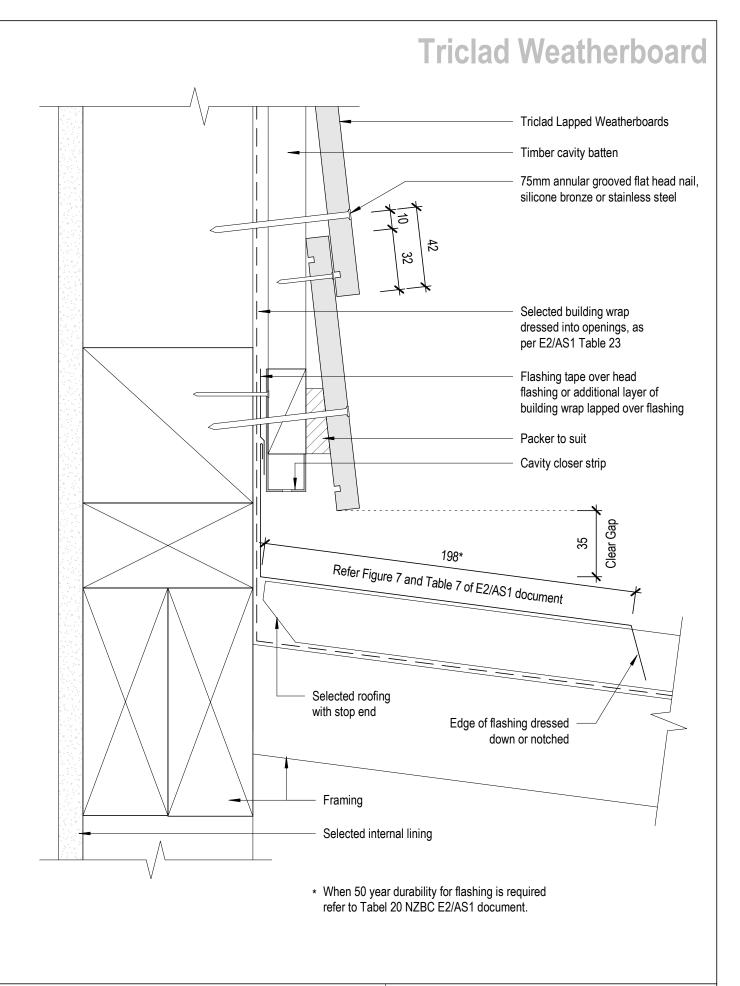




8 Quail Place Hamilton Lake Hamilton New Zealand

Cavity Fix Roof/Wall Detail

1:2@A4 Scale

Sept 2019 Date

Fig 19 Dwg

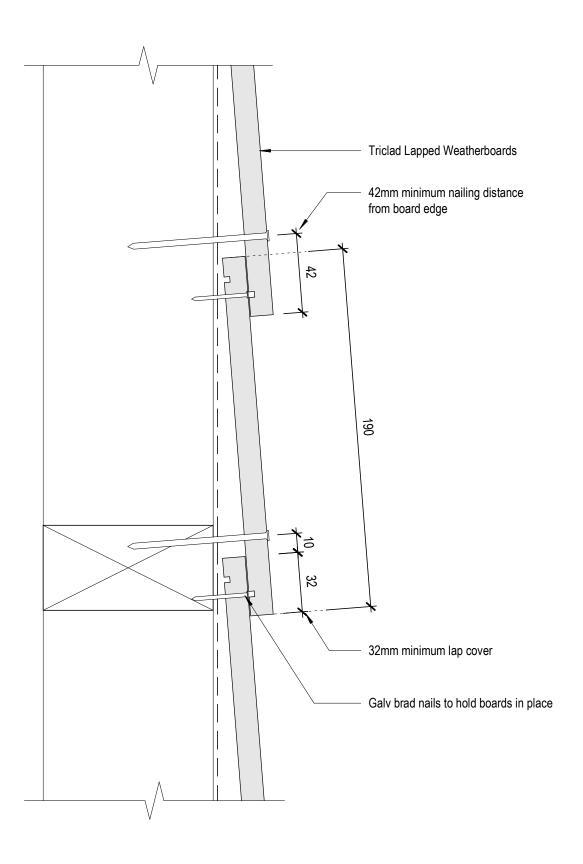




8 Quail Place Hamilton Lake Hamilton New Zealand

Direct Fix Nailing Setout Detail

1:2@A4 Scale Sept 2019 Date Fig 20

Dwg

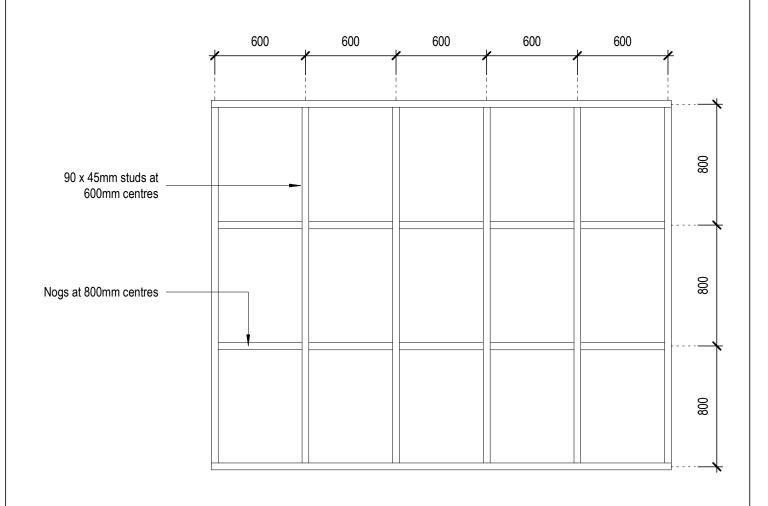




8 Quail Place Hamilton Lake Hamilton New Zealand

Direct Fix Framing/Batten Setout

1:25 @ A4 Scale Sept 2019 Fig 21
Date Dwg

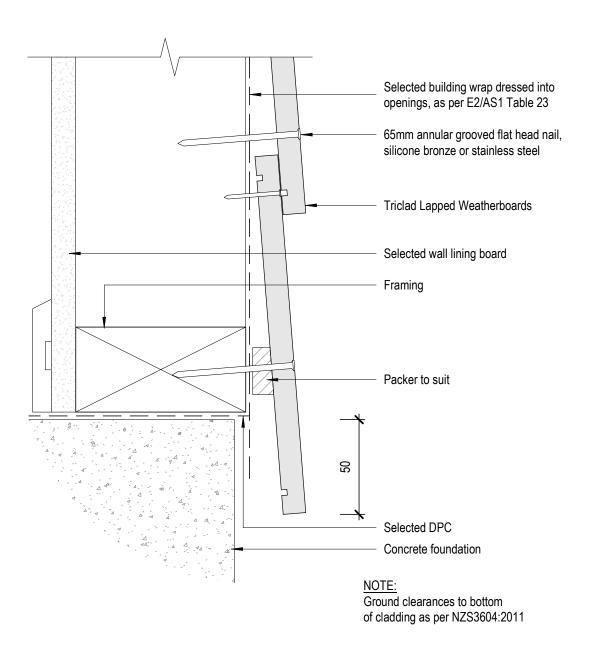




8 Quail Place Hamilton Lake Hamilton New Zealand

Direct Fix Base Detail-Concrete Floor

1:2@A4 Sept 2019 Scale Date

Fig 22 Dwg

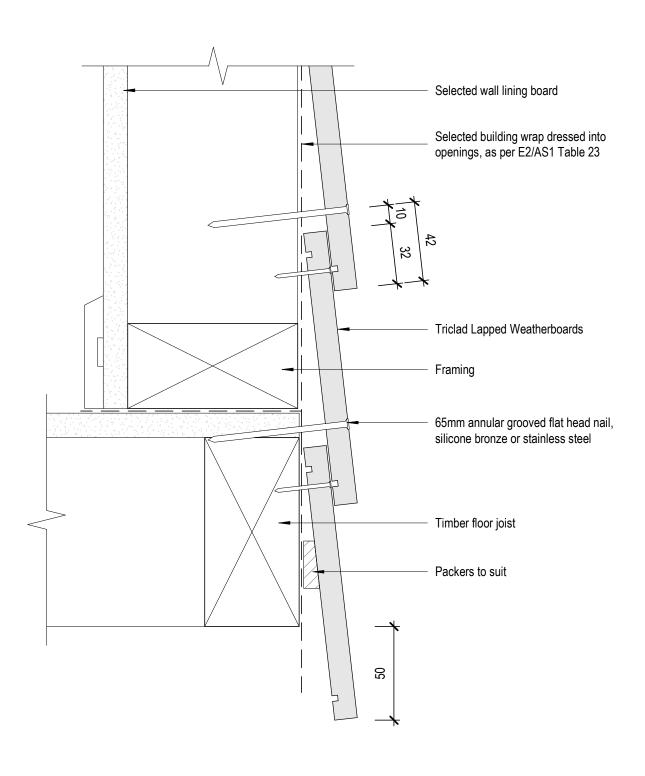




8 Quail Place Hamilton Lake Hamilton New Zealand

Direct Fix Base Detail-Timber Floor

1:2@A4 Scale Sept 2019 Fig 23
Date Dwg

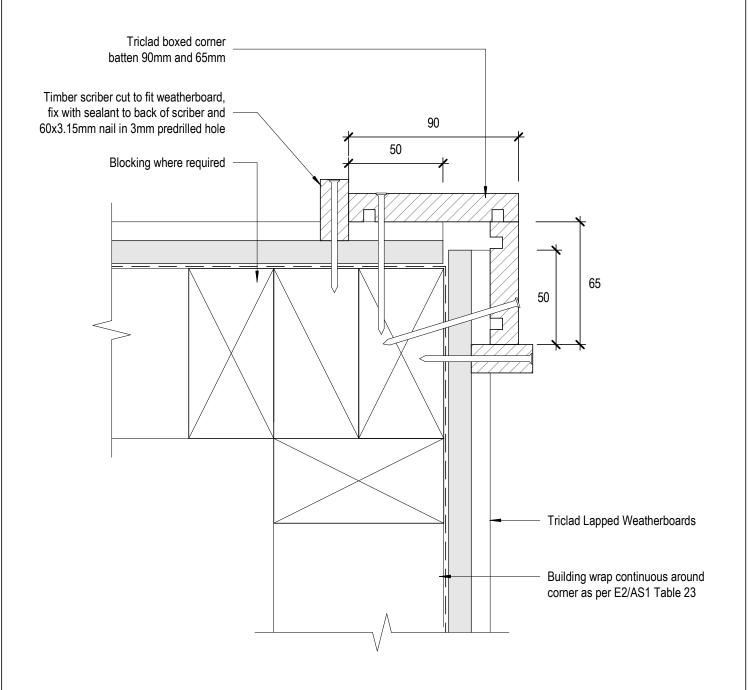




8 Quail Place Hamilton Lake Hamilton New Zealand

www.triclad.co.nz

Direct Fix External Corner-Boxed

1:2@A4 Scale Sept 2019 Fig 24
Date Dwg

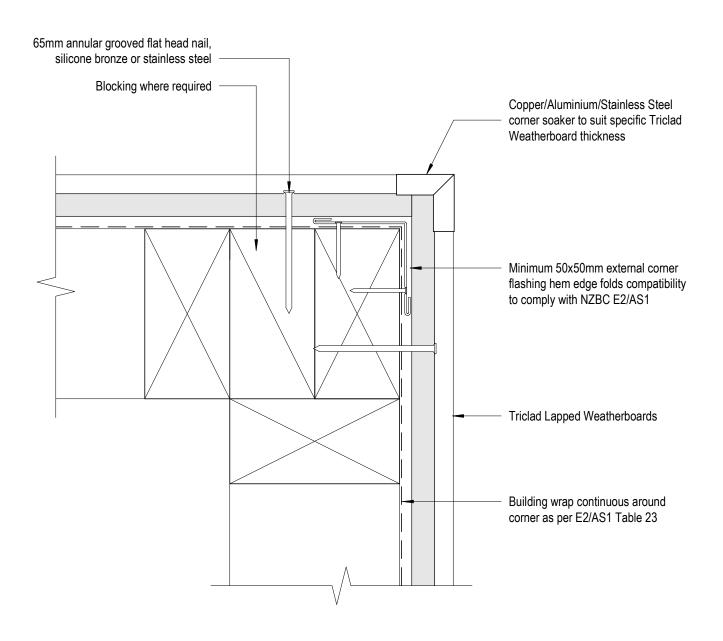




8 Quail Place Hamilton Lake Hamilton New Zealand

Direct Fix External Corner-Soaker

1:2@A4 Scale Sept 2019 Date

Fig 25 Dwg

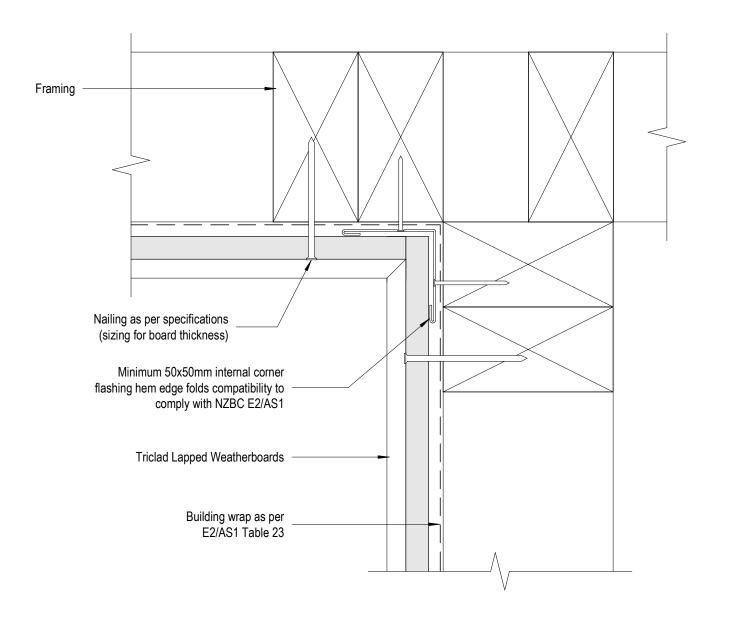




8 Quail Place Hamilton Lake Hamilton New Zealand

Direct Fix Internal Corner-Option 1

1:2@A4 Scale Sept 2019 Date **Fig 26** Dwg

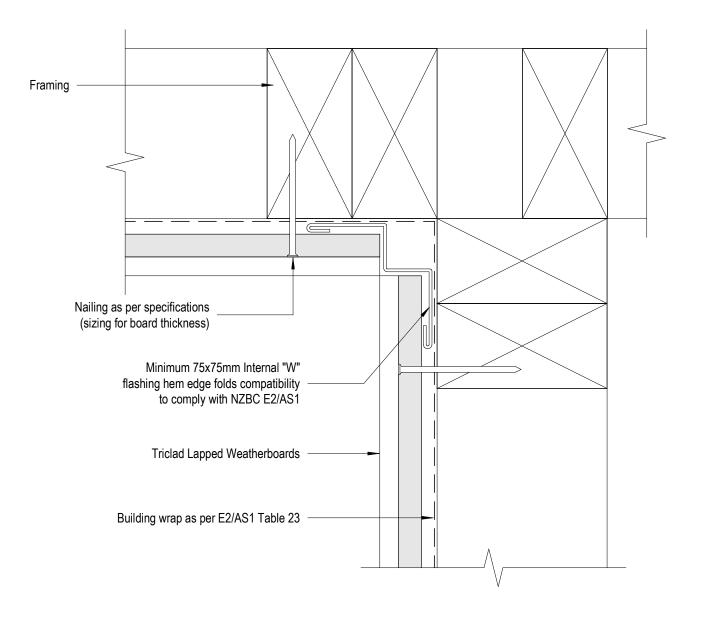




8 Quail Place Hamilton Lake Hamilton New Zealand

Direct Fix Internal Corner-Option 2

1:2@A4 Scale Sept 2019 Date Fig 27

Dwg

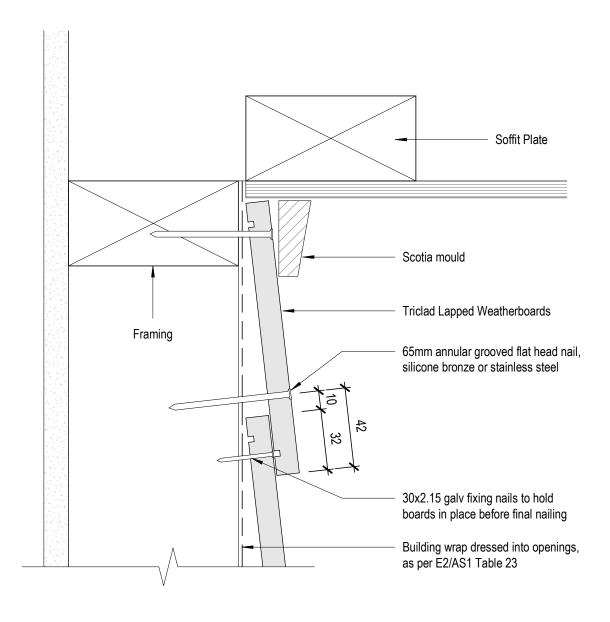




8 Quail Place Hamilton Lake Hamilton New Zealand

Direct Fix Soffit Detail

1:2@A4 Scale

Sept 2019 Fig 28
Date Dwg

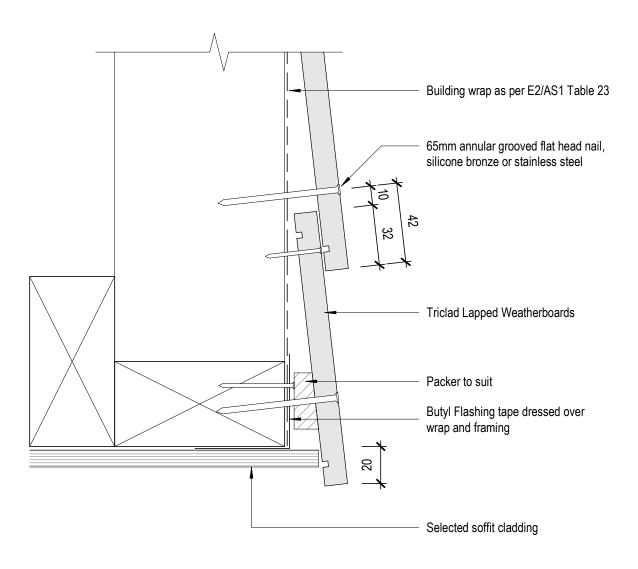




8 Quail Place Hamilton Lake Hamilton New Zealand

Direct Fix Soffit/Beam Detail

1:2@A4 Scale Sept 2019 Date Fig 29 Dwg

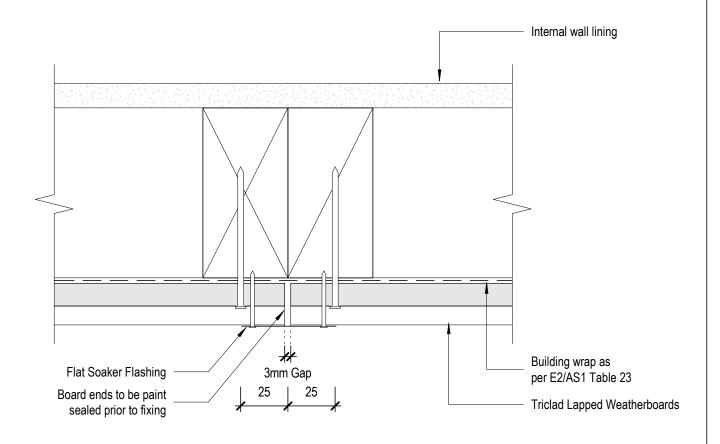




8 Quail Place Hamilton Lake Hamilton New Zealand

Direct Fix Board Joint Detail

1:2@A4 Scale Sept 2019 Date Fig 30 Dwg

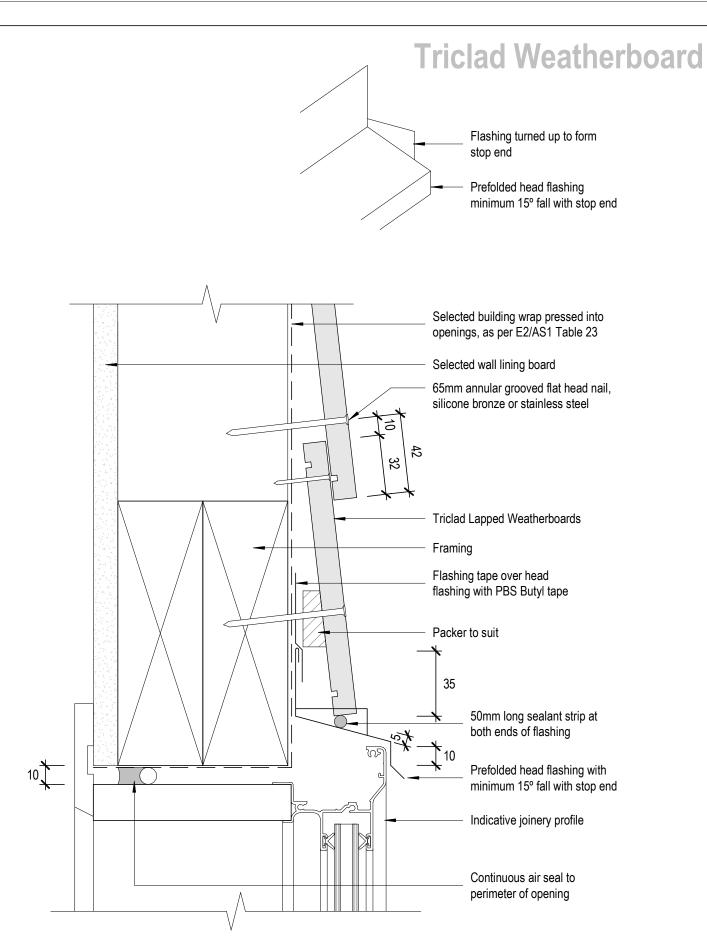




8 Quail Place Hamilton Lake Hamilton New Zealand

Direct Fix Window Head Detail-Aluminium

Scale Date

1:2@A4 **Sept 2019** Fig 31 Dwg

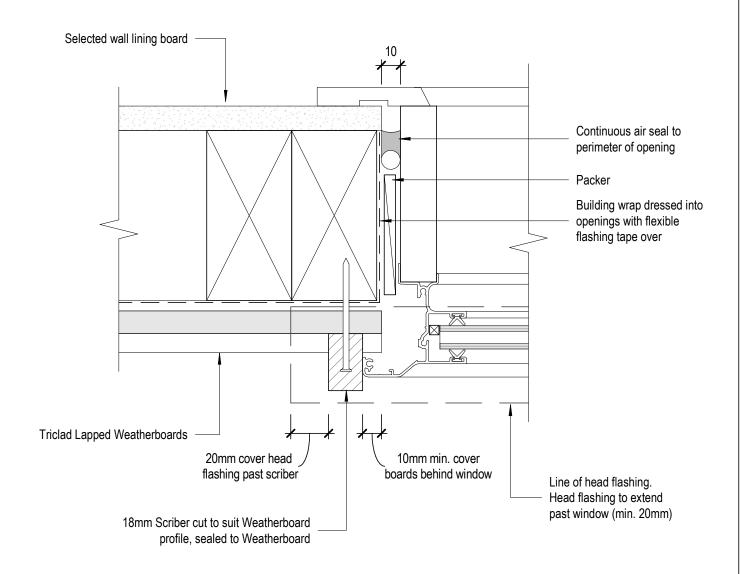




8 Quail Place Hamilton Lake Hamilton New Zealand

www.triclad.co.nz

Direct Fix Window Jamb Detail-Aluminium

1:2@A4 Scale Sept 2019 Fig 32
Date Dwg

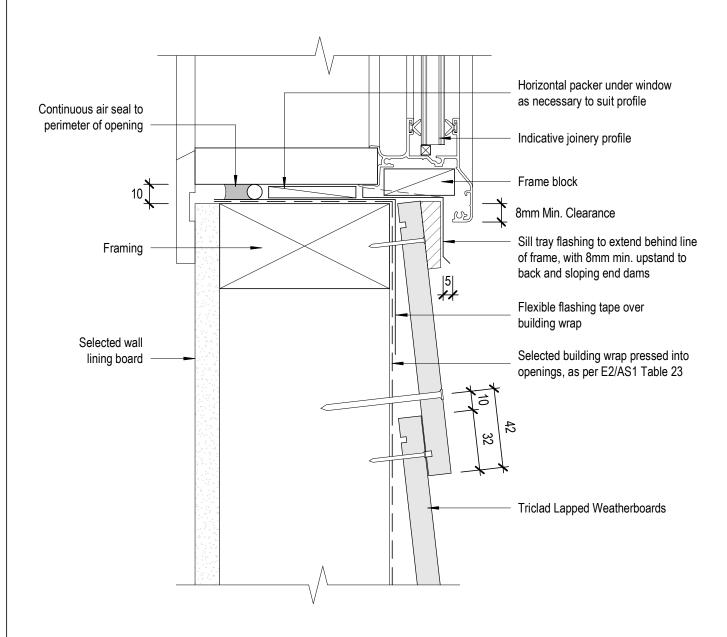




8 Quail Place Hamilton Lake Hamilton New Zealand

Direct Fix Window Sill Detail-Aluminium

1:2@A4 Scale Sept 2019 Fig 33
Date Dwg

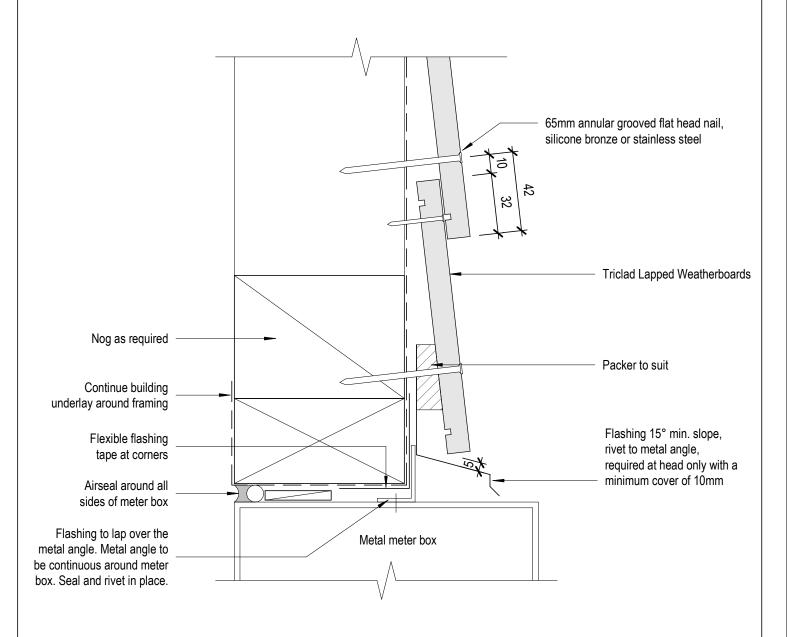




8 Quail Place Hamilton Lake Hamilton New Zealand

Direct Fix Meter Box Head

1:2@A4 Scale Sept 2019 Date Fig 34 Dwg

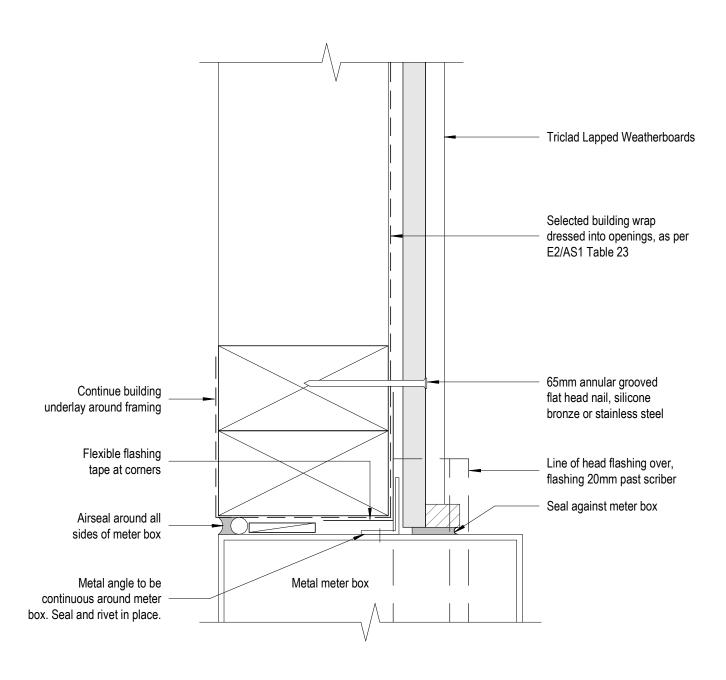




8 Quail Place Hamilton Lake Hamilton New Zealand

Direct Fix Meter Box Jamb

1:2@A4 Scale

Sept 2019 Date Fig 35

Dwg

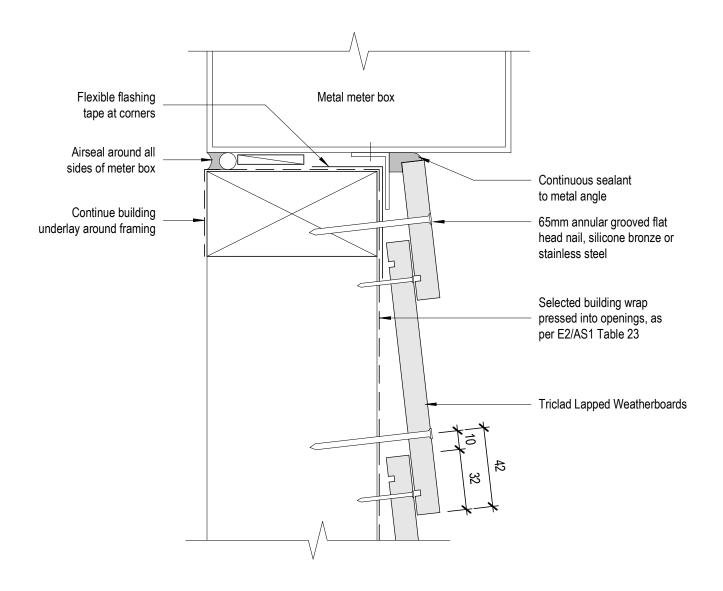




8 Quail Place Hamilton Lake Hamilton New Zealand

Direct Fix Meter Box Sill

1:2@A4 Scale Sept 2019 Fig 36
Date Dwg

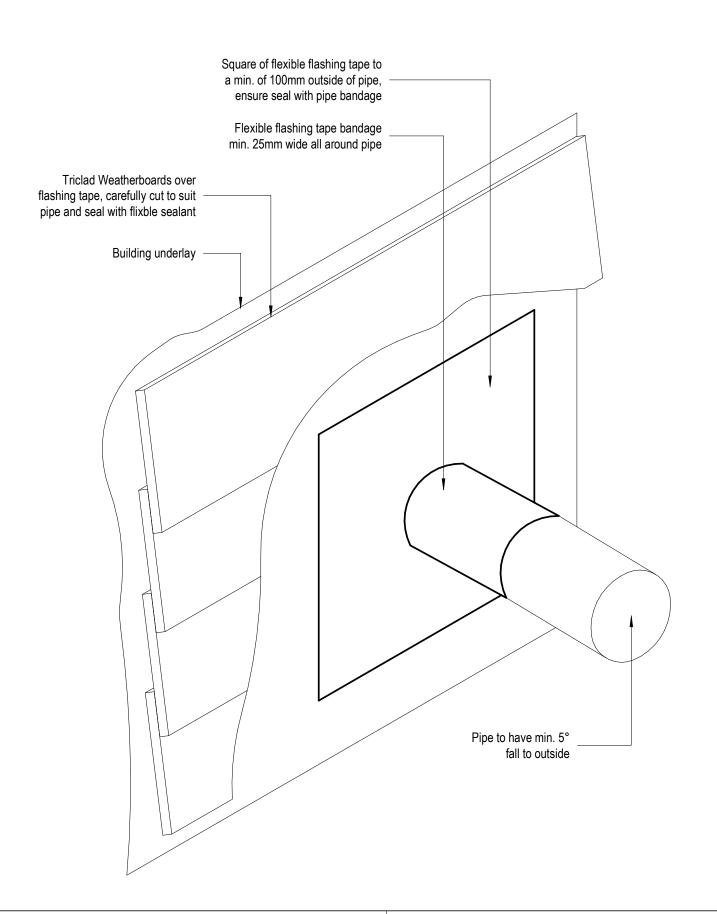




8 Quail Place Hamilton Lake Hamilton New Zealand

Direct Fix Penetration Detail

1 : 5 @ A4 Sept 2019 Scale Date

Fig 37

Dwg

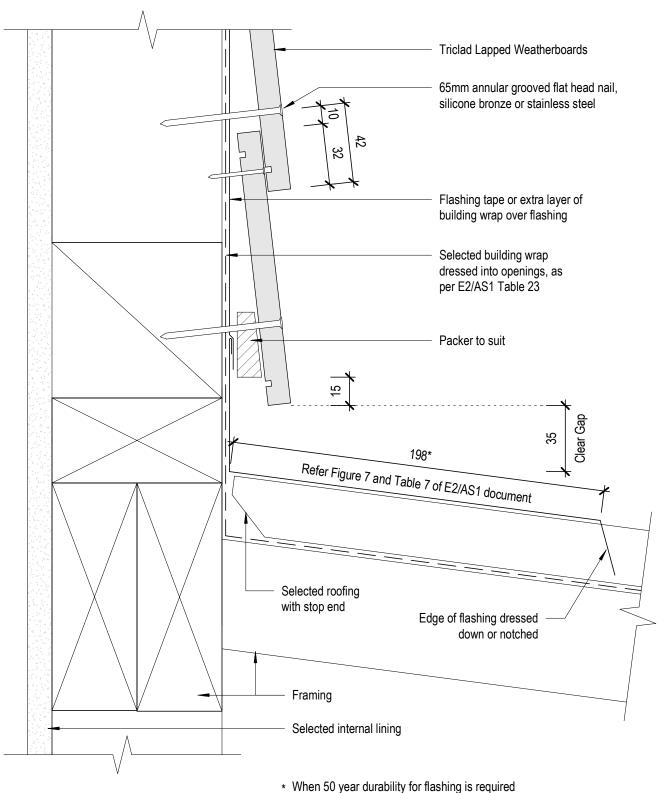

 When 50 year durability for flashing is required refer to Tabel 20 NZBC E2/AS1 document.



8 Quail Place Hamilton Lake Hamilton New Zealand

Direct Fix Roof/Wall Detail

1:2@A4 Scale Sept 2019 Fig 38
Date Dwg